




Operating instructions

Multichannel Calibrator PASCAL 100 and PASCAL 100/IS

GB





 Part of your business

GB

Operating instructions PASCAL 100

Page

1 - 85

Rev. 09 – April 2017.

© 2017 WIKA Alexander Wiegand SE & Co. KG

All rights reserved.

WIKA® is a registered trademark in various countries.

Prior to starting any work, read the operating instructions!
Keep for later use!

Contents

1	General Information.....	5
2	Safety	6
2.1	Intended use	7
2.2	Personnel qualification.....	7
2.3	Additional safety instructions for instruments with ATEX approval only Pascal 100/IS	8
2.4	Special hazards	9
2.5	Labelling / safety marks	10
3	Specifications	11
4	Design and Function	15
4.1	Description	15
4.2	Scope of delivery	16
4.3	Power supply	16
5	Transport, packaging and storage	17
5.1	Transport.....	17
5.2	Packaging	17
5.3	Storage	17
6	Commissioning, operation.....	18
6.1	Commissioning	18
6.1.1	Instrument Overview	18
6.1.2	Functional Modules.....	18
6.2	Pressure.....	24
6.2.1	Pneumatic circuit.....	24
6.3	Electrical	26
6.3.1	Electrical measurements.....	26
6.3.2	Thermocouple measurements	27
6.3.3	Thermoresistance measurements	28
6.3.4	Generation of electrical parameters.....	29
6.3.5	Thermocouple simulation.....	29
6.3.6	Thermoresistance simulation	30
6.4	User Interface	31
6.4.1	Channel configuration	33
6.4.2	Other assignments.....	39
6.5	Setting channel, function, instrument.....	58
6.5.1	Channel setting	58
6.5.2	Functions setting.....	61
6.5.3	Instrument setting	62
6.6	Channel settings	64
6.6.1	Offset On – Offset Off	64
6.6.2	Scaling	65
6.6.3	Hold On – Hold Off.....	66
6.6.4	Modification of the generation/simulation value.....	66
6.7	Report	67
6.7.1	Report of Tc/Rtd with dry well calibrator or dry block management	72
6.8	Data Logger	78
6.9	Communication	80
6.10	Calibration Examples	80
6.10.1	Example 1 – Calibration of 2-wire pressure transmitters.....	80

6.10.2	Example 2 – Calibration of PTZ gas volume converters	81
6.10.3	Example 3 – Calibration of 4-wire RTD's.....	82
6.10.4	Example 4 – Calibration of Thermocouples.....	83
7	Maintenance, cleaning and servicing.....	84
7.1	Maintenance	84
7.2	Cleaning	84
7.3	Recalibration	84
8	Dismounting, return and disposal.....	85
8.1	Dismounting	85
8.2	Return	85
8.3	Disposal	85

Declarations of conformity can be found online at www.wika.com.

1 General Information

- The Multichannel Calibrator model Pascal 100 or Pascal 100/IS described in the operating instructions has been manufactured using state-of-the-art technology. All components are subject to stringent quality and environmental criteria during production. Our management systems are certified to ISO 9001 and ISO 14001.
- These operating instructions contain important information on handling the Multichannel Calibrator model Pascal 100 or Pascal 100/IS. Working safely requires that all safety instructions and work instructions are observed.
- Observe the relevant local accident prevention regulations and general safety regulations for the range of use of the Multichannel Calibrator model Pascal 100 or Pascal 100/IS.
- The operating instructions are part of the instrument and must be kept in the immediate vicinity of the Multichannel Calibrator model Pascal 100 or Pascal 100/IS and readily accessible to skilled personnel at any time.
- Skilled personnel must have carefully read and understood the operating instructions, prior to beginning any work.
- The manufacturer's liability is void in the case of any damage caused by using the product contrary to its intended use, non-compliance with these operating instructions, assignment of insufficiently qualified skilled personnel or unauthorised modifications to the Pascal 100 or Pascal 100/IS.
- The general terms and conditions, contained in the sales documentation, shall apply.
- Subject to technical modifications.
- Factory calibrations/DKD/DAkks calibrations are carried out in accordance with international standards.
- Further information:
 - Internet address: www.wika.de / www.wika.com
 - Relevant Data Sheet: CT 18.01
 - Application consultant: Tel.: (+49) 9372/132-9986
Fax: (+49) 9372/132-8767
E-Mail: testequip@wika.de

Explanation of symbols

GB



WARNING!

... indicates a potentially dangerous situation, which can result in serious injury or death, if not avoided.



Information

... points out useful tips, recommendations and information for efficient and trouble-free operation.



WARNING!

... indicates a potentially dangerous situation in a potentially explosive atmosphere, resulting in serious injury or death, if not avoided.

2 Safety



WARNING!

Before installation, commissioning and operation, ensure that the appropriate reference pressure sensor has been selected in terms of measuring range, design and specific measuring conditions. Serious injuries and/or damage can occur should these not be observed.



Further important safety instructions can be found in the individual chapters of these operating instructions.

2.1 Intended use

The Multichannel Calibrator model Pascal 100 or Pascal 100 IS gauge can be used as a calibration instrument and also for any application which requires accuracy pressure measurement.

The Multichannel Calibrator model Pascal 100 or Pascal 100/IS has been designed and built solely for the intended use described here, and may only be used accordingly.

The technical specifications contained in these operating instructions must be observed. Improper handling or operation of the Multichannel Calibrator model Pascal 100 or Pascal 100/IS outside of its technical specifications requires the instrument to be shut down immediately and inspected by an authorised WIKA service engineer.

Handle electronic precision measuring instruments with the required care (protect from strong magnetic fields, static electricity and extreme temperatures, do not insert any objects into the instrument or its openings). Plugs and sockets must be protected from contamination.

If the Multichannel Calibrator model Pascal 100 or Pascal 100/IS is transported from a cold into a warm environment, the formation of condensation may result in the instrument malfunctioning. Before putting it back into operation, wait for the instrument temperature and the room temperature to equalise.

The manufacturer shall not be liable for claims of any type based on operation contrary to the intended use.

2.2 Personnel qualification



WARNING!

Risk of injury should qualification be insufficient!

Improper handling can result in considerable injury and damage to equipment.

- The activities described in these operating instructions may only be carried out by skilled personnel who have the qualifications described below.

Skilled personnel

Skilled personnel are understood to be personnel who, based on their technical training, knowledge of measurement and control technology and on their experience and knowledge of country-specific regulations, current standards and directives, are capable of carrying out the work described and independently recognizing potential hazards.

Special operating conditions require further appropriate knowledge, e.g. of aggressive media.

2.3 Additional safety instructions for instruments with ATEX approval only Pascal 100/IS

GB



WARNING!

Non-observance of these instructions and their contents may result in the loss of explosion protection.

- Battery operation:
Use only the rechargeable battery which is supplied by WIKA! Only charge the battery outside of the hazardous area!
- Operation of the serial interface in the hazardous area is prohibited.



Further hazardous area safety instructions!

Observe the operating information and the relevant country-specific regulations concerning use in hazardous areas (e.g. EN IEC 60079-14).

The Pascal 100/IS intrinsically safe multichannel calibrator has been designed for use in Ex Hazardous Areas. These are areas where potentially flammable or explosive vapors may occur. These areas are referred to as hazardous (classified) locations in the United States, as Hazardous Locations in Canada, as Potentially Explosive Atmospheres in Europe and as Explosive Gas Atmospheres by most of the rest of the world. The Pascal 100/IS intrinsically safe multichannel calibrator is designed as intrinsically safe. This means that connecting the Pascal 100/IS intrinsically safe multichannel calibrator to equipment that is used within intrinsically safe circuits will not cause an ignition capable arc as long as the entity parameters are suitably matched.

Information/Approval for hazardous locations:



WARNING!

■ Ex Hazardous Areas

An Ex-hazardous area as used in this manual refers to an area made hazardous by the potential presence of flammable or explosive vapors. These areas are also referred to as hazardous locations.



II 2G

Ex ib IIC T4 Gb - Tamb: -10°C / 50°C



WARNING!

Only gauges powered by batteries are approved for use in hazardous locations. Use only the rechargeable battery which is supplied by WIKA! Only charge the battery outside of the hazardous area!

2.4 Special hazards



WARNING!

- When measuring pressure, make sure that the process pressure line is shut off and depressurised before it is connected to or disconnected from the pressure module.
- Disconnect test leads before changing to another measurement or generation function.
- Observe the working conditions in accordance with chapter "3. Specifications".
- Always operate the device within its overload limits.
- To ensure problem-free operation, only operate the Multichannel Calibrator model Pascal 100 or Pascal 100/IS on battery power. Only use the mains connection for charging the Hand-held pressure calibrators batteries.
- Do not apply a voltage greater than the specified voltage to the instrument. See chapter "3. Specifications".
- Make sure that the test probes never contact a voltage source while the test leads are connected to the current terminals.
- Do not use the calibrator if it is damaged. Before using the multichannel calibrator, check that there are no cracks or missing plastic parts on the case. Pay particular attention to the insulation of the connectors.
- Select the proper function and correct measuring range for the measurement.
- Inspect the test leads for damaged insulation or exposed metal. Check the continuity of the test leads. Damaged test leads should be replaced before using the multichannel calibrator.
- When using test probes keep fingers away from the test probe contacts. Keep your fingers behind the test probes' finger guards.
- First connect the common lead, and then the live lead. When disconnecting, remove the live test lead first.
- Do not use the multichannel calibrator if it is not working properly. The instrument protection might be compromised. If in doubt, have the instrument checked.
- Do not operate the calibrator in areas with explosive gases, vapours or dust.
- To avoid false readings, which could lead to possible electric shock or personal injury, charge the rechargeable battery as soon as the battery indicator appears.
- In order to avoid any possible damage to the multichannel calibrator or the test equipment, use the correct leads, the correct function and the correct range for the measuring application.

2.5 Labelling / safety marks

GB

Explanation of symbols

Pascal 100 and Pascal 100/IS



Before mounting and commissioning the Multichannel Calibrator model Pascal 100 or Pascal 100/IS, ensure you read the operating instructions!



CE, European Community

Instruments bearing this mark comply with the relevant European directives.



This marking on the instruments indicates that they must not be disposed of in domestic waste. The disposal is carried out by return to the manufacturer or by the corresponding municipal authorities. See Directive 2002/96/EC.

Only Pascal 100/IS



ATEX European Explosion Protection Directive

(Atmosphère = AT, explosible = Ex)

Instruments bearing this mark comply with the requirements of the European Directive 94/9/CE (ATEX) on explosion protection.



IECEx for IEC 60079-0, IEC 60079-11

3 Specifications

Base instrument	
Indication	
Display	Touchscreen + 5 keys
Dimensions	640 x 480 Dots Dot size: 0.06 x 0.06 mm (0.002 x 0.002 in)
Backlight	LED
Electrical input and output	
Number and type	banana-plug inputs for electrical parameters, resistance thermometers and thermocouples
Resistance thermometer (RTD)	Pt100 (385, 3616, 3906, 3926, 3923), Pt200, Pt500, Pt1000 (385, 3916), Ni100, Ni120, Cu10, Cu100
Thermocouples	Types J, K, T, F, R, S, B, U, L, N, E, C
Voltage signal	input: DC ± 100 mV, ± 2 V, ± 80 V output: DC 20 V
Current signal	input: DC ± 100 mA output: DC 20 mA ¹⁾
Frequency signal	0 ... 50,000 Hz
Pulses signal	1 ... 999,999
Resistance	0 ... 10,000 Ω
Voltage supply	DC 24 V
HART® communication	
HART® module	based on HART® universal and common practice commands
Resistance	HART® resistance 250 Ω (activatable)
Loop current	max. DC 24 mA
Voltage supply	DC 24 V
Pressure connection	1/8 BSP (female)
Permissible media	clean, dry, non-corrosive gases
Temperature compensation	-10 ... +50 °C (14 ... 122 °F)
Temperature coefficient	0.001 % of reading/°C, outside of 19 ... 23 °C (66 ... 73 °F)
Units	bar, mbar, psi, psf, Pa, hPa, kPa, MPa, torr, atm, kg/cm ² , kg/m ² , mmHg (0 °C), cmHg (0 °C), mHg (0 °C), inHg (0 °C), mmH ₂ O (4 °C), cmH ₂ O (4 °C), mH ₂ O (4 °C), inH ₂ O (4 °C), ftH ₂ O (4 °C)

3 Specifications

GB

Base instrument

Voltage supply

Battery type	rechargeable battery NiMH
Battery life (fully-charged)	8 hours for typical usage
Power supply	AC 100 ... 240 V, 50/60 Hz

Permissible ambient conditions

Operating temperature	-10 ... +50 °C (14 ... 122 °F)
Storage temperature	-30 ... +80 °C (-22 ... +176 °F)
Relative humidity	Operating humidity: 10 ... 90 % r. h. (non-condensing) Storage humidity: 0 ... 90 % r. h. (non-condensing)

Case

Material	Front panel aluminium
Ingress protection	IP54
Dimensions	330 x 270 x 170 mm (13 x 10.6 x 7 in)
Weight	6 kg (13 lbs 2 oz)

Ignition protection type for model Pascal 100/IS

ATEX directive	II 2G Ex ib IIC T4 Gb - T _{amb} : -10 ... +50 °C
----------------	---






Connection values

Max. voltage	U ₀ = 29.7 V
Max. current	I ₀ = 31 mA
Max. power	P ₀ = 0.92 W
Max. effective internal capacitance	C ₀ = 69 nF
Max. effective internal inductance	L ₀ = 30 mH



Power supply circuit

Max. voltage	U _i = 30 V
Max. current	I _i = 100 mA
Max. power	P _i = 0.75 W
Max. effective internal capacitance	C _i = negligible
Max. effective internal inductance	L _i = negligible

Approvals for Pascal 100/IS

Logo	Description	Country
 	EU declaration of conformity ■ EMC directive EN 61326 emission (group 1, class B) and interference immunity (portable test and measuring equipment) ■ Low voltage directive ■ ATEX directive II 2G Ex ib IIC T4 Gb - T _{amb} : -10 ... +50 °C	European Union
	IECEx for IEC 60079-0, IEC 60079-11	IECEx member states
	BelGIM Metrology, measurement technology	Belarus
	DNOP-MakNII Hazardous areas	Ukraine
-	MTSCHS Permission for commissioning	Kazakhstan

Approvals for Pascal 100

Logo	Description	Country
	EAC ■ Electromagnetic compatibility ■ Low voltage directive	Eurasian Economic Community
	BelGIM Metrology, measurement technology	Belarus
-	MTSCHS Permission for commissioning	Kazakhstan

Certificates


Certificate	
Calibration	Standard: 3.1 calibration certificate per DIN EN 10204 Option: ACCREDIA calibration certificate
Recommended recalibration interval	1 year (dependent on conditions of use)

Approvals and certificates, see website




GB

Case for models Pascal 100 and Pascal 100/IS

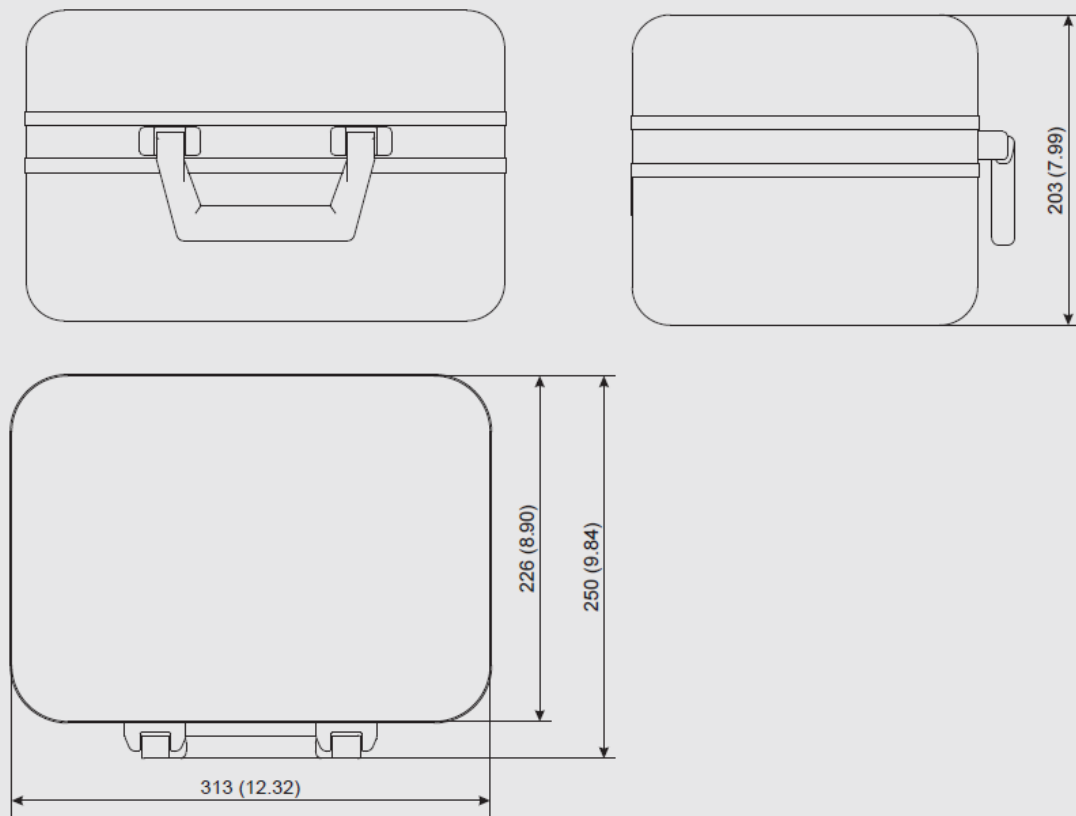

Front panel of model Pascal 100/IS

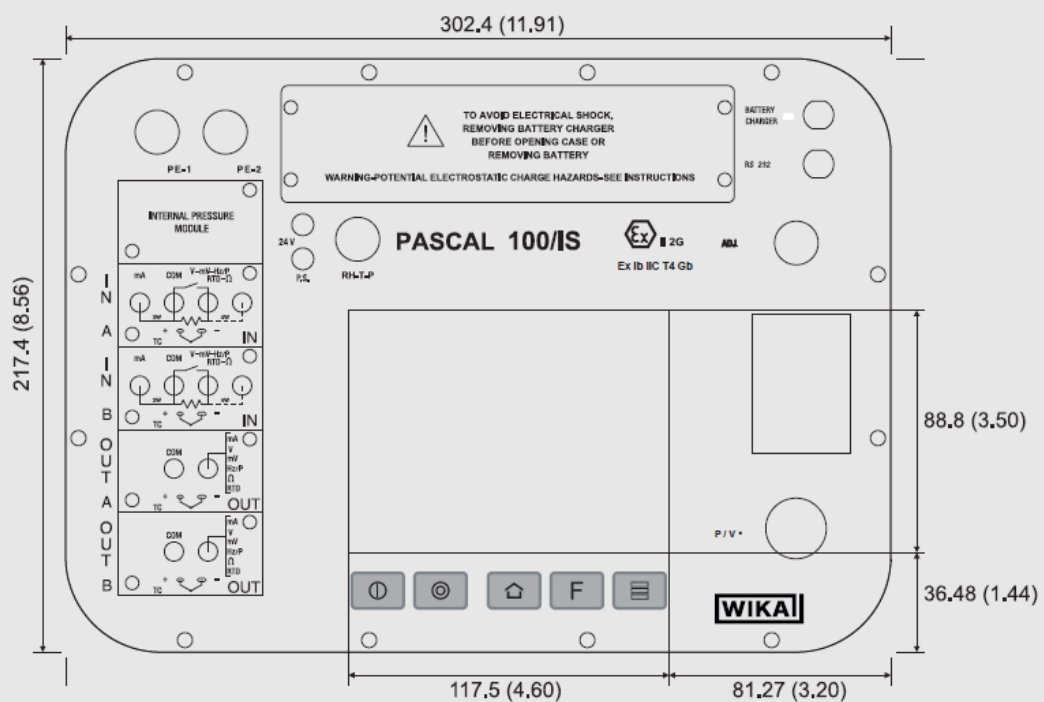

For further specifications see WIKA data sheet CT 18.01 and the order documentation.

4 Design and Function

4.1 Description

Pascal 100 or Pascal 100/IS is the Professional Advanced Superior Calibrator of latest generation. User friendly interface by a wide display with an industrial touch screen through which it is possible to manage the instrument completely.

The operations are simplified thanks to the touch screen: the display changes in a dynamic way according to the user selections, following test by step the operator during the calibration process, decreasing the learning time and the human errors.

The touch screen can be operated by nude or gloved hands: dirty parts can be easily removed with a cloth or a sponge. The touch screen can be locked during the measurement process to avoid unintentional pressing of keys.

The backlight illumination with LED guarantees a perfect view in case of low environmental visibility. Five keys are present below the touch screen: turn on/off of the instrument, contrast settings and backlight.

The electrical part of Pascal 100 or Pascal 100/IS consists from two until 4 electrical modules to be selected between the available ones (2 inputs (IN) – 2 outputs (OUT) – one HART module) for measuring and generating mA, mV, V, Hz, Ohm, Pulse, TC/RTD.

The Pascal 100 or Pascal 100/IS consists of two parts: pressure part and electrical one.

The pressure part consists of one or two connectors for connecting the external pressure sensors:

- pneumatic distribution block
- internal manual vacuum/pressure generator with fine adjustment
- up to four internal pressure sensors with overpressure valves.

The electrical part consists of up to four electrical module (2 inputs (IN), 2 outputs (OUT) and a HART module) for the measurement and generation of mA, mV, V, Hz, Ohm, Pulse, TC/RTD.

On the front panel of the instrument there are several connectors for:

- recharging the battery
- RS232 port
- Connection to the external pressure transducers
- Connection for the environment parameters (temperature, humidity and atmospheric pressure)

Moreover there are the connections to provide 24 V d.c. power supply to the device under test. The Pascal 100 or Pascal 100/IS is powered with an internal battery pack. The battery allows 6 hours of standard operation before recharging.

Operating Pascal 100 or Pascal 100/IS user is able to calibrate the whole industrial instrumentation like for example:

- Electronic and pneumatic pressure/vacuum transmitter
- Electronic and pneumatic differential pressure transmitter
- Electronic and pneumatic temperature transmitter (thermocouple and RTD)
- Signal converter V, mV, mA, Hz, Pulse, ohm
- Signal converter I/P and P/I
- Signal isolator mA, mV
- Mathematical Device (adder, subtractor, multiplier, divider)
- Manometer, Pressure switch
- Temperature monitor switch
- Thermocouple and thermoresistance
- Compensation device (up to 4 in-out signals)
- Electronic and pneumatic receiver
- Electronic and pneumatic controller
- Electronic and pneumatic recorder
- Miscellaneous instrument

Pascal 100 or Pascal 100/IS includes different modules and can be ordered with different hardware configurations.

GB

The hardware configuration depends on the installation of different functional modules:

- Two electrical/temperature IN modules (IN A & IN B)
- Two electrical/temperature OUT modules (OUT A & OUT B)
- Two pressure modules
(each one can support two internal and one external transducer. Total 6 sensors)
- One environment parameters module
(atmospheric pressure, ambient temperature and relative humidity)
- One power supply 24 V d.c.
- One RS-232 communication port
- One connection for recharging the battery
- One hand pump for pressure or vacuum generation
- One fine adjustment for a good regulation of pressure or vacuum
- One set of valves for sensor protection against overpressure



Battery Life

In order to preserve battery life is recommended to keep the battery charger connected for no more than 36 hours



Functional module

A functional module is a hardware component that allows the Pascal 100 or Pascal 100/IS to perform some operations like for example measurement and generation of electrical signals and pressure.

4.2 Scope of delivery

- Portable multifunction calibrator model Pascal 100 or Pascal 100/IS
- Operating instructions
- AC adapter
- Pascal report software
- RS-232 interface cable
- RS-232 to USB adapter
- Electrical kit order no. 241076
- Pneumatic pressure kit order no. 241028 and 241029
(Depending on pressure range)
- 3.1 calibration certificate per DIN EN 10204

Cross-check scope of delivery with delivery note.

4.3 Power supply

Charging

To avoid false measurements, charge the rechargeable batteries as soon as the battery indicator appears. If the batteries run too low the Pascal 100 or Pascal 100/IS will automatically shut down.



Use only the original AC/DC converter which is supplied by WIKA

5 Transport, packaging and storage

5.1 Transport

Check the Multichannel Calibrator model Pascal 100 or Pascal 100/IS for any damage that may have been caused by transport. Obvious damage must be reported immediately.

5.2 Packaging

Do not remove packaging until just before mounting.

Keep the packaging as it will provide optimum protection during transport (e.g. sending for calibration).

5.3 Storage

Permissible conditions at the place of storage:

- Storage temperature: -30 ... +80 °C
- Relative Humidity: 10 ... 90 % r. H. (non-condensing)

Avoid exposure to the following factors:

- Direct sunlight or proximity to hot objects
- Mechanical vibration, mechanical shock (putting it down hard)
- Soot, vapour, dust and corrosive gases
- Potentially explosive environments, flammable atmospheres

Store the instrument in its original packaging in a location that fulfills the conditions listed above. If the original packaging is not available, pack and store the instrument as described below:

1. Wrap the instrument in an antistatic plastic film.
2. Place the instrument, along with shock-absorbent material, in the packaging.
3. If stored for a prolonged period of time (more than 30 days), place a bag, containing a desiccant, inside the packaging.

6 Commissioning, operation

GB

6.1 Commissioning

6.1.1 Instrument Overview



- | | |
|---|---|
| 1 Connectors for external P transducer | 10 Hand pump (vacuum/21 bar) |
| 2 Pressure modules | 11 Pneumatic distribution |
| 3 IN electrical/temperature modules | 12 Fine adjustment |
| 4 OUT electrical/temperature modules | 13 Connector RS-232 |
| 5 Power ON | 14 Connector for battery charger |
| 6 Power OFF | 15 Battery |
| 7 Home | 16 Environmental Parameter Connector |
| 8 Programmable Function | 17 Loop power supply – 24 V d.c. |
| 9 Changing the number of windows | |

6.1.2 Functional Modules

The functional modules can be classified according to their assignments:

- Electrical and temperature signals measurement
- Pressure measurement, (2 different modules, up to 4 internal pressure sensors and 2 connectors for external pressure sensor)
- Electrical and temperature signals generation/simulation
- Pressure generation and regulation
- Environmental parameters measurement

Many different configurations are available according to the specific requirements of the user.

6.1.2.1 Input module for electrical/temperature signals

The input module for electrical/temperature parameters measurement is one of those modules inserted from the instrument's front panel; two slides drive the module into its position. It is possible to have up to two input modules in the same instrument: IN A and IN B. This terminology is used also by the software to carry out the connection between physical input IN and software channel. For example: if you connect a thermoresistance Pt100 to module IN A, the temperature measured by this thermoresistance can be displayed in any of the four available windows. The following figure shows the pins connection in electrical/temperature IN module.

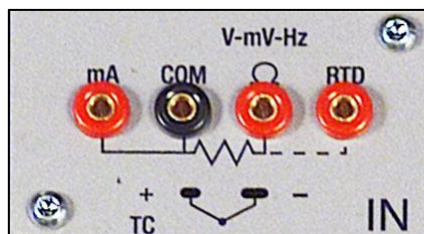


Figure 1 – Input panel module

6.1.2.2 Output module for electrical/temperature signals

The output module for electrical/temperature parameters generation or simulation is one of those inserted from the instrument's front panel; two slides drive the module into its position. It is possible to have up to two output modules in the same instrument: OUT A and OUT B. This terminology is used also by the software to carry out the connection between physical output OUT and software channel. For example: if you connect a signal-receiver to module output OUT A, the current 4...20 mA generated can be displayed in any of the four available windows.

The following figure shows the output module for electrical/temperature parameters.

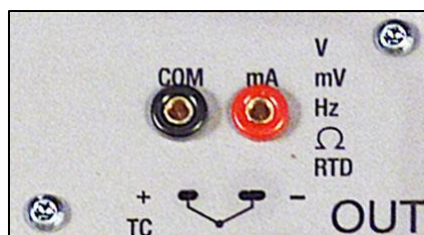


Figure 2 – Output panel module

The 2 INPUT cards and 2 OUTPUT cards are plug and play modules and can be installed by the user himself.

6.1.2.3 Pressure module

The pressure module is installed only at factory location in accordance with the Pascal 100 or Pascal 100/IS configuration required. It is possible to install two pressure modules, each one can support up to two internal and one external transducers. In total Pascal 100 can accommodate four internal and two external transducers. Transducer's selection with range and their resolutions are in the following table. If requested, one of the standard pressure modules can be changed with one high accuracy pressure module (with one high accuracy transducer).

Internal transducers *

Range	Precision (% FS)	Accuracy (% FS)	Typical Resolution
Gauge			
-60...+60 mbar	0.1	0.15	0.001 mbar
-500...+500 mbar	0.015	0.025	0.001 mbar
-900...+1500 bar	0.015	0.025	0.01 mbar
0...7 bar	0.015	0.025	0,1 mbar
0...21 bar	0.015	0.025	0.1 mbar
0...50 bar	0.015	0.025	1 mbar
0...100 bar	0.015	0.025	1 mbar
Absolute			
600...1300 mbar abs.	0.015	0.025	0.01 mbar
0...1500 mbar abs.	0.015	0.025	0.01 mbar
0...2500 mbar abs.	0.015	0.025	0.01 mbar
0...5 bar abs.	0.015	0.025	0.1 mbar
0...7 bar abs.	0.015	0.025	0.1 mbar
0...21 bar abs.	0.015	0.025	0.1 mbar
0...81 bar abs.	0.015	0.025	1 mbar
0...100 bar abs.	0.015	0.025	1 mbar

External transducers *

Range	Precision (% FS)	Accuracy (% FS)	Typical Resolution
Gauge			
-60...+60 mbar	0.1	0.15	0.001 mbar
-500...+500 mbar	0.015	0.025	0.001 mbar
-900...+1500 bar	0.015	0.025	0.001 mbar
0...7 bar	0.015	0.025	0.1 mbar
0...21 bar	0.015	0.025	0.1 mbar
0...50 bar	0.015	0.025	1 mbar
0...100 bar	0.015	0.025	1 mbar
0...200 bar	0.015	0.025	10 mbar
0...400 bar	0.015	0.025	100 mbar
0...700 bar	0.025	0.05	100 mbar
0...1000 bar	0.025	0.05	100 mbar
Absolute			
0...1500 mbar abs.	0.015	0.025	0.01 mbar
0...2500 mbar abs.	0.015	0.025	0.01 mbar
0...5 bar abs.	0.015	0.025	0.1 mbar
0...7 bar abs.	0.015	0.025	0.1 mbar
0...21 bar abs.	0.015	0.025	0.1 mbar
0...81 bar abs.	0.015	0.025	1 mbar
0...100 bar abs.	0.015	0.025	1 mbar

* Other ranges available on request

6.1.2.4 HART module

The HART module allows communication with HART instruments (usually transmitters) permitting to acquire digital measurements, instrument data and modifying settings. It can be inserted in the front panel in place of OUT A or OUT B module.

It is a fully galvanically isolated board (like IN and OUT modules) from internal electronics of the Pascal.

The module allow the 24V to supply directly the output loop for the transmitter.

Further, it can supply a 250Ω load resistance electronically switchable necessary to HART communication, permitting to avoid the use of an external one.

The following figure shows the pin connections in HART module:



Figure 3 – HART module

6.1.2.4.1 HART wiring

Depending by several factors and combination that the user can found in a plant, there are many wiring possibility depending by:

- Using module internal or external Power Supply.
- Using internal or external load resistance.
- Simultaneous analog connection of AO TRX to one Input module for mA reading

Please consider, if the user enable the internal load resistance, this will be connected between the +HART and COM terminals.

Here same examples:

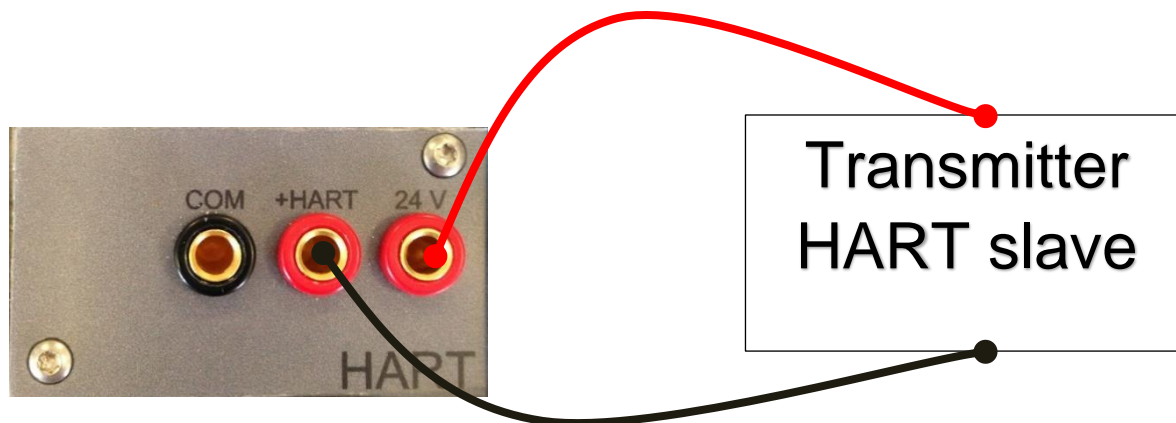


Figure 4 - Case 1: 24V from module, 250Ω from module

GB

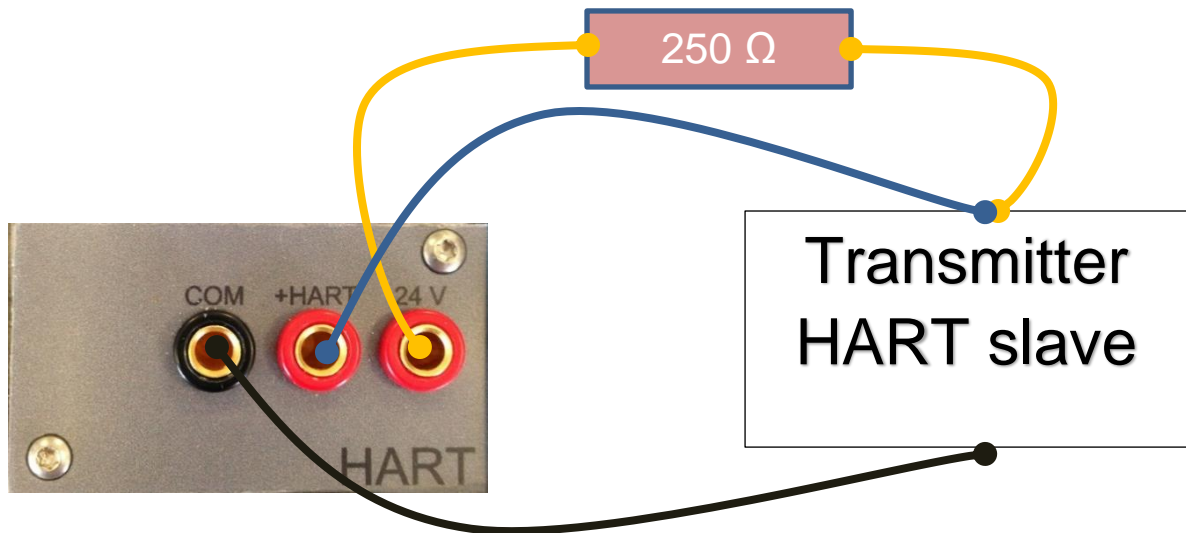


Figure 5 - Case 2: 24V from module, 250Ω external

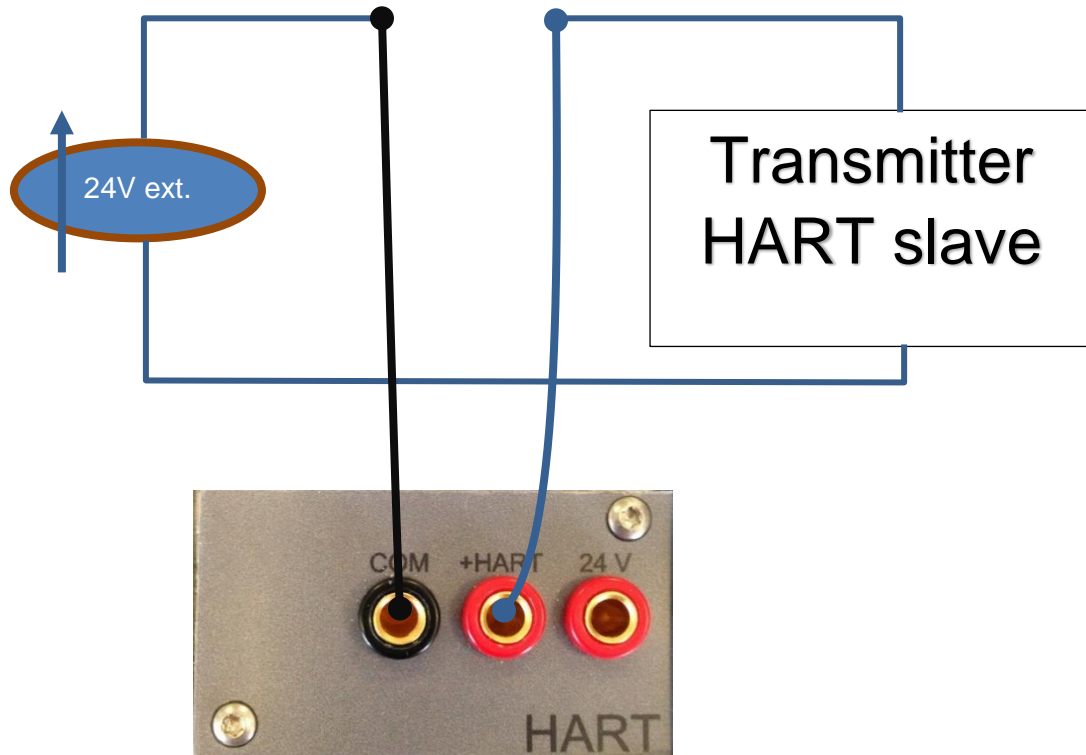


Figure 6 - Case 3: 24V external, 250Ω from module

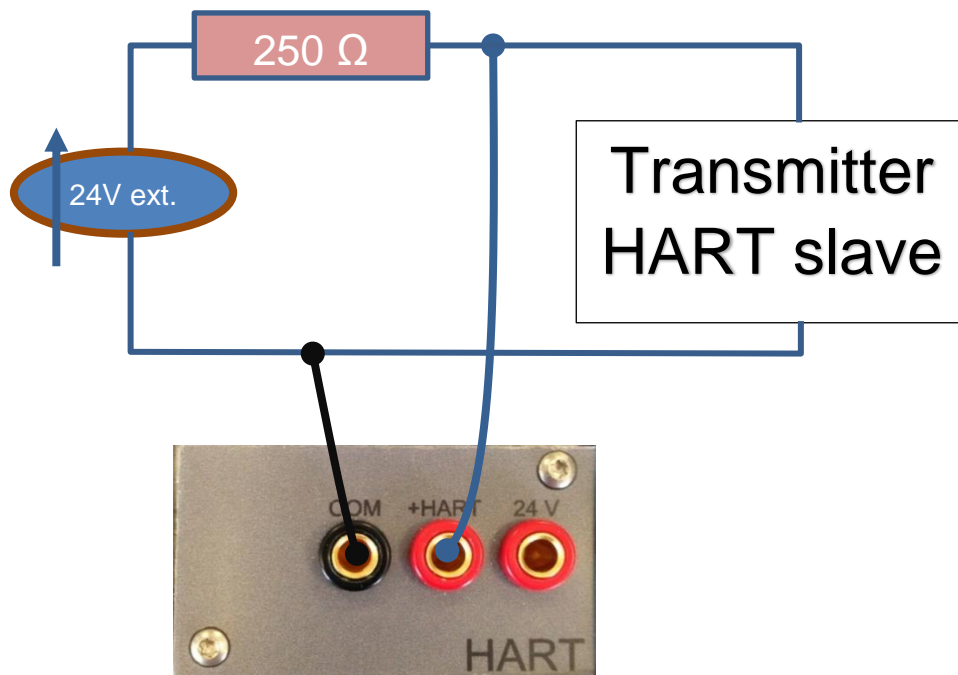


Figure 7 - Case 4: 24V external, 250Ω external

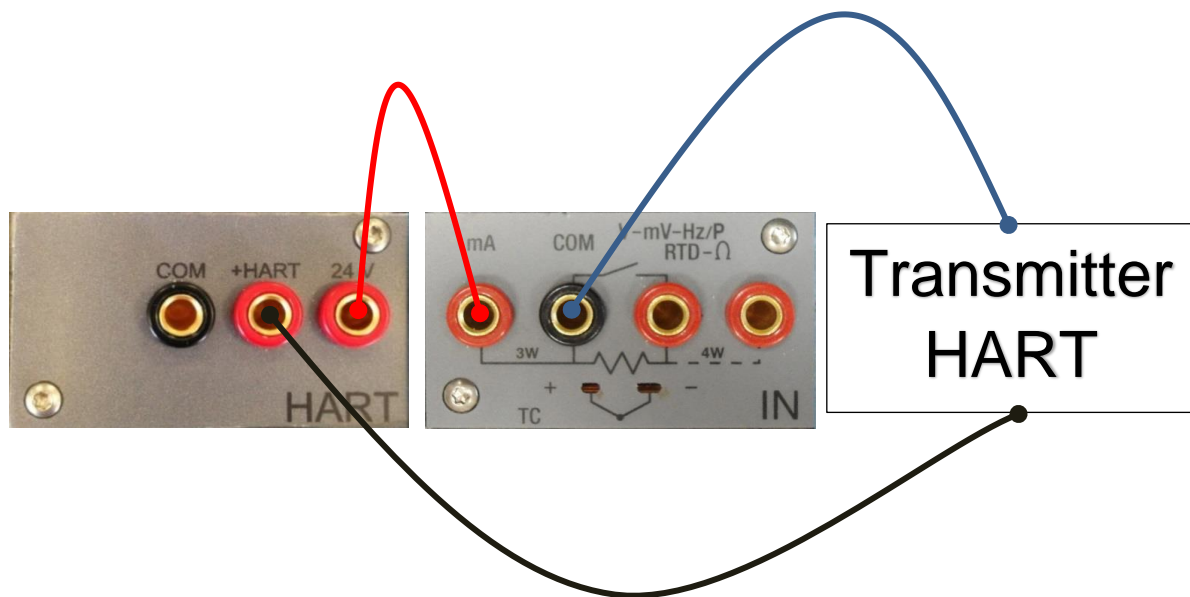


Figure 8 - Case 8: 24V from module, 250Ω from module, mA reading by IN module

6.1.2.5 Environmental parameters module (optional)

This module allows to measure: temperature, relative humidity and atmospheric pressure. These parameters represent the most important factors that affect the calibration results. This module is connected to Pascal 100 or Pascal 100/IS with a multiple pin connector present in Pascal 100 or Pascal 100/IS front panel. This module is plug & play and the relevant information about the environmental parameters are displayed on the status bar at the top of the screen. This information is automatically reported on the calibration report.

Parameter	Range	Precision	Uncertainty	Max. resolution
Temperature	-10 ... +50 °C	2.7 °C	3.0 °C	0,1 °C
Barometric pressure	650 ... 1150) mbar	4 % fs	5 % fs	1 mbar
Relative humidity	10 ... 90 %	12 %	15 %	1 %

6.2 Pressure

GB

6.2.1 Pneumatic circuit

Pascal 100 or Pascal 100/IS can be equipped with four internal and two external pressure sensors. The internal sensors work only with clean dry gas (like dry air) whereas the external sensors can work with gas or liquid. Gas is related to pneumatic circuit and liquid to hydraulic circuits.

Pascal 100 or Pascal 100/IS has a pneumatic circuit that gives possibility to execute a large number of calibration in an easy way for connecting the device under test. An integrated pump and a fine adjustment allow to generate the required pressure. The generated pressure, according to the model, can be distributed in parallel to all sensors. The sensors whose ranges are much lower than the maximum pressure generated in the pneumatic circuit are protected from overpressure by a mechanical valve that closes the circuit when the pressure gets over its range.

Switching the pressure-vacuum selector in the vacuum position is possible to generate vacuum (pressure under the barometric)

For example, if we want to measure a signal from pneumatic instrument 3 - 15 PSI or to measure high gas pressure over 21 bar and we use an internal sensor directly connected to the process, we must pay attention not to damage it by applying pressure over its range.

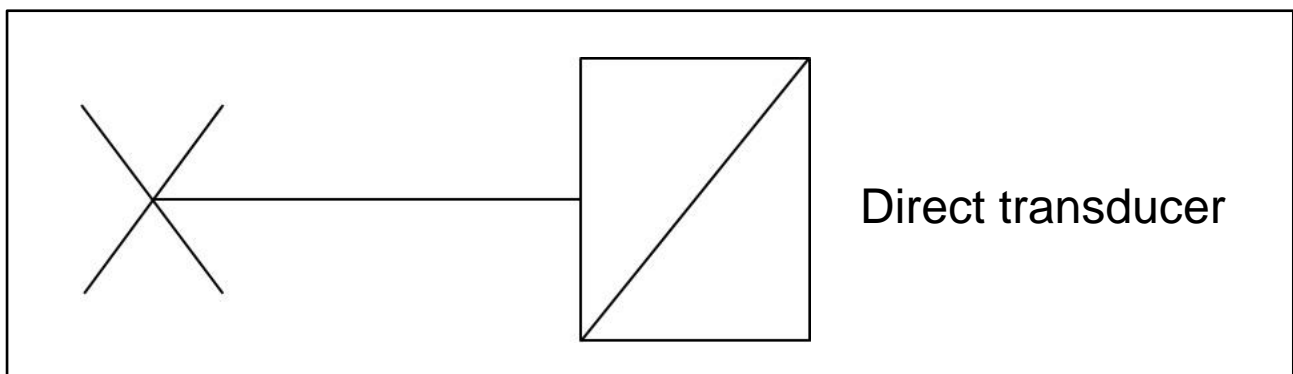


Figure 9 – Direct transducer

There are three different pneumatic schemes available in a standard Pascal 100 or Pascal 100/IS configuration:

- This is an example of pneumatic circuit with two sensors in parallel to the pump. One of them is protected by an overpressure valve, the other one is not protected because it has a full-scale equal to the maximum pressure generated by the pump. See following:

GB

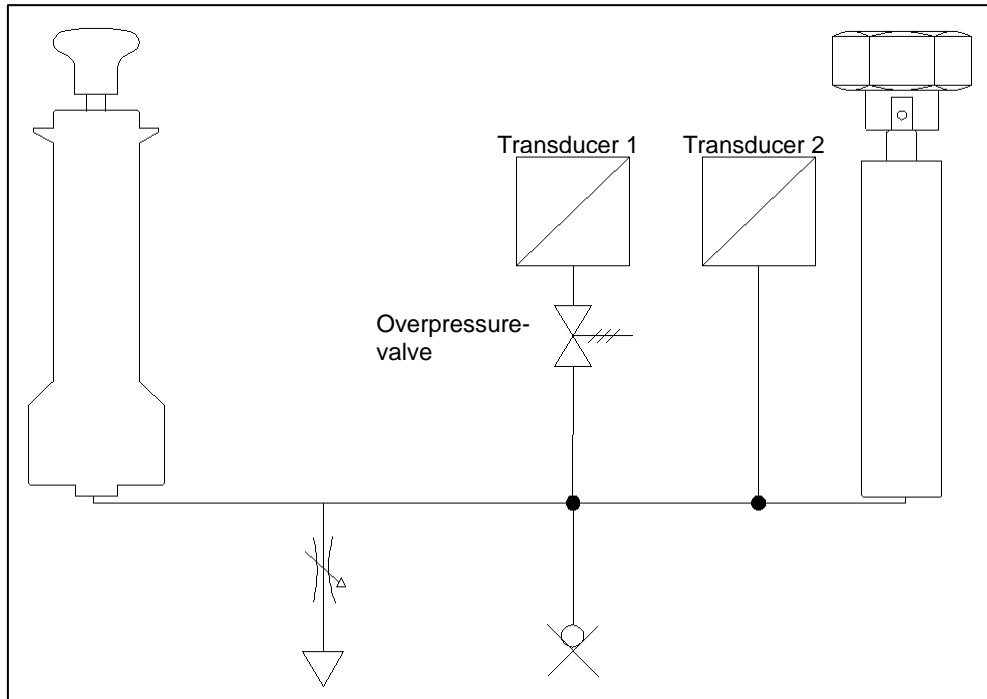


Figure 10 – Circuit with two sensors in parallel

- This is an example of pneumatic circuit with two sensors: one sensor connected in parallel to the pump with over pressure protection, and one sensor directly connected for measuring the external pressure signals without overpressure protection. See following:

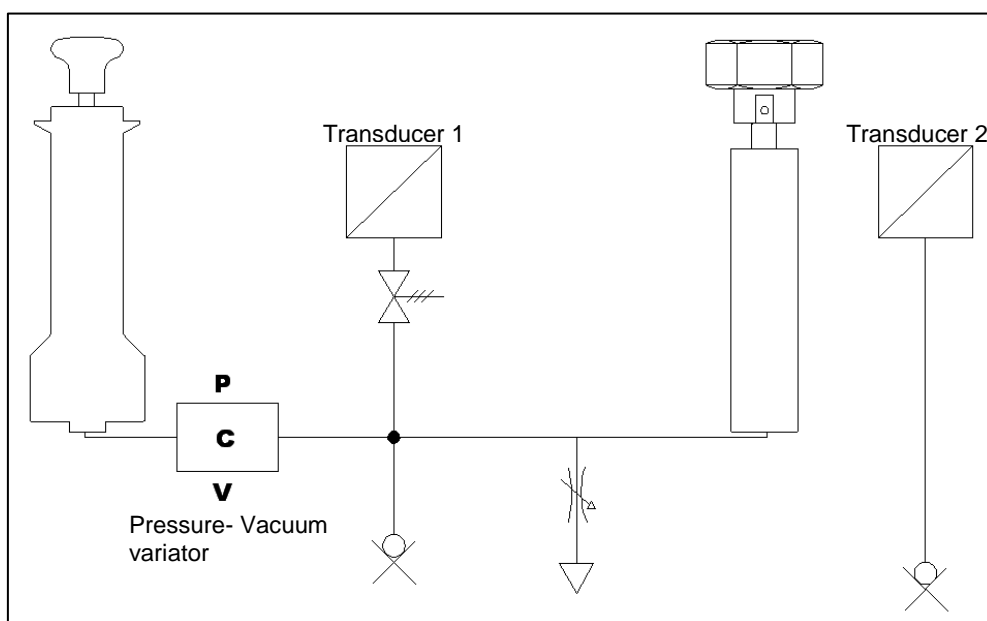


Figure 11 - Circuit with transducer connected to process

- This is an example of pneumatic circuit with four sensors: three of them are connected in parallel to the pumps and one straight to external. Two of them are protected by overpressure valves, the other one is not protected because it has its full-scale equal to the maximum pressure generated by pump. See following:

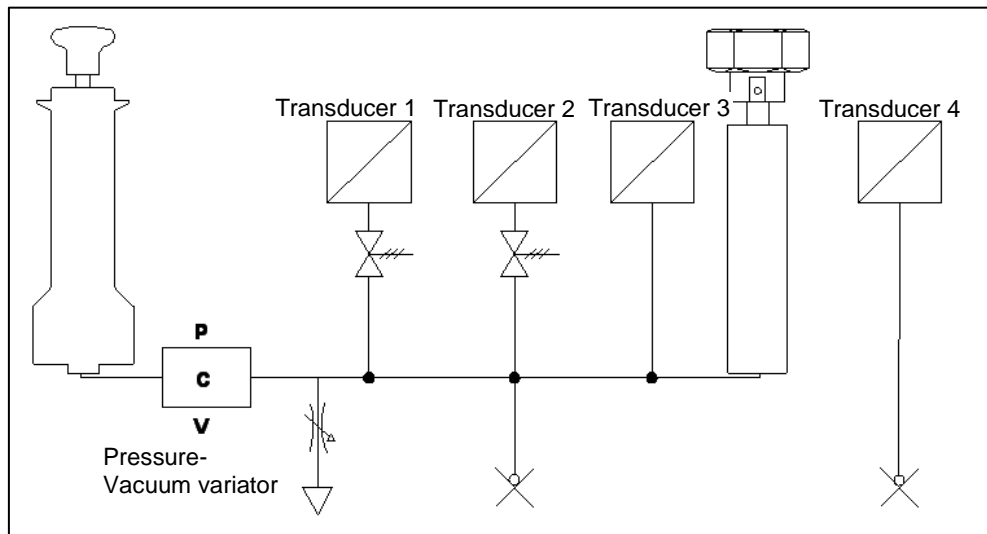


Figure 12 - Circuit with four transducers

6.3 Electrical

The Pascal 100 or Pascal 100/IS is a multifunction calibrator.

The electrical modules can be maximum four, two of them are input modules (IN A – IN B), and the other two are output modules (OUT A – OUT B).

6.3.1 Electrical measurements

The instrument is able to measure voltage, current, resistance and frequency. To optimize the resolution and get better measurement results, there are three ranges for voltage measurement, two for resistance measurements, one range for current and three ranges for frequency.

Ranges of measurement and resolutions are specified in following table:

Range	Max resolution
Voltage	
(-100...100) mV	0.0001 mV
(-2...2) V	0.000001 V
(-80...80) V	0.00001 V
Current	
(-100...100) mA	0.0001 mA
Resistance	
(0...400) Ω	0.001 Ω
(0...10000) Ω	0.01 Ω
Frequency	
(0.4...50000) Hz	0.001 Hz
Pulse	
0,4...20 Hz	-
Contact	
Open - Closed	-

Table 1 - Range of input signals

6.3.2 Thermocouple measurements

The electrical module measures signals from the thermocouple and shows it in different engineering units (°C, °F, K).

Thermocouple types, measuring range, linearity error and related resolutions are given in the following table:

Type	Range/°C	Resolution/°C Max
J	-210...1200	0.1
	-190...1200	0.01
K	-270...1370	0.1
	-160...1260	0.01
T	-270...400	0.1
	-130...400	0.01
F	0...1400	0.1
	0...1400	0.01
R	-50...1760	0.1
	150...1760	0.01
S	-50...1760	0.1
	170...1760	0.01
B	50...1820	0.1
	920...1820	0.01
U	-200...400	0.1
	-160...400	0.01
L	-200...760	0.1
	-200...760	0.01
N	-270...1300	0.1
	0...1300	0.01
E	-270...1000	0.1
	-200...1000	0.01
C	0...2300	0.1
	0...2000	0.01
M	-50...1410	0.1
	-50...1410	0.01

Table 2 – Thermocouple measurements table

It is possible to perform the measurement in two different ways: with internal reference (cold junction), with external reference cold junction by entering the reference value through the keyboard. When internal reference cold junction is selected, the ambient temperature is measured through the thermocouple pins using a special thermoresistance. This temperature value is used for compensation. The Standard connector Mignon for thermocouple is shown in Figure 1. The thermoresistance for compensation of the reference cold junction is integrated in the same connector.

6.3.3 Thermoresistance measurements

The electrical module measures signals from thermoresistance and shows it in different engineering units (°C, °F, K).

Thermoresistance types, measuring range and related resolutions are given in the following table:

Type	Range/°C	Resolution/°C Max
Pt100 (385)	-200...850	0.1
	-200...850	0.01
Pt100 (3916)	-200...850	0.1
	-200...850	0.01
Pt100 (3926)	-200...850	0.1
	-200...850	0.01
Pt100 (3902)	-200...650	0.1
	-200...650	0.01
Pt100 (3923)	-200...600	0.1
	-200...600	0.01
Pt100 JIS (3916)	-200...600	0.1
	-200...600	0.01
Pt200 (385)	-200...850	0.1
	-200...850	0.01
Pt500 (385)	-200...850	0.1
	-200...530	0.01
Pt1000 (385)	-200...850	0.1
	-200...850	0.01
Pt1000 (3916)	-200...850	0.1
	-200...850	0.01
Ni100 (617)	-60...180	0.1
	-60...180	0.01
Ni120 (672)	0...150	0.1
	0...150	0.01
Cu10 (42)	-70...150	0.1
	-70...150	0.01
Cu100	-180...150	0.1
	-180...150	0.01

Table 3 - Thermoresistance measurements table

It is possible to connect the thermoresistance according to the type of measurement: 2 wires, 3 wires and 4 wires. The two wires measurement is performed without any compensation of the connecting cables resistances; in this case the connection is among the two central (COM - Ω) pins. In the case of three wires connection the pin identified with the writing 3W must also be used. While for the four wires measurement, the most accurate of the above, is performed by using all four pins.

6.3.4 Generation of electrical parameters

The output module (OUT) allows to generate voltage, current, resistance and frequency. For the voltage there are three different ranges with different resolutions. Resistance has two ranges while current and frequency have only one range. Ranges and resolutions are given in the following table:

Range	Max resolution
Voltage	
(0...100) mV	0.0001 mV
(0...2) V	0.000001 V
(0...20) V	0.00001 V
Current	
(0...20) mA	0.0001 mA
Resistance	
(0...400) Ω	0.001 Ω
(0...10000) Ω	0.01 Ω
Frequency	
(0,5...20000) Hz	0.001 Hz
Pulse	
(0,5...200) Hz / 9999999 impulse	

Table 4 – Range of output signals

6.3.5 Thermocouple simulation

Through the output module it is possible to simulate thermocouples. This function can be used to test and calibrate: thermocouple transmitters, analogue or digital indicator. A thermoresistance Pt100, inserted in isothermal contact with the connectors, measures the ambient temperature for the cold junction compensation. It is possible to disable the automatic cold junction compensation and set out the reference temperature by the keyboard.

The instrument can simulate thermocouple types indicated in the following table:

Type	Range/°C	Resolution/°C Max
J	-210...1200	0.1
	-190...1200	0.01
K	-270...1370	0.1
	-160...1260	0.01
T	-270...400	0.1
	-130...400	0.01
F	0...1400	0.1
	0...1400	0.01
R	-50...1760	0.1
	150...1760	0.01
S	-50...1760	0.1
	170...1760	0.01
B	50...1820	0.1
	920...1820	0.01
U	-200...400	0.1
	-160...400	0.01
L	-200...760	0.1
	-200...760	0.01
N	-270...1300	0.1
	0...1300	0.01
E	-270...1000	0.1
	-200...1000	0.01
C	0...2300	0.1
	0...2000	0.01
M	-50...1410	0.1
	-50...1410	0.01

Table 5 – Thermocouple simulation table

6.3.6 Thermoresistance simulation

Through the output module (OUT) it is possible to simulate thermoresistance. This function can be used to check and calibrate: temperature transmitters – analogue or digital indicators.

The instrument can simulate thermoresistance types indicated in the following table:

Type	Range/°C	Resolution/°C Max
Pt100 (385)	-200...850	0.1
	-200...850	0.01
Pt100 (3916)	-200...850	0.1
	-200...850	0.01
Pt100 (3926)	-200...850	0.1
	-200...850	0.01
Pt100 (3902)	-200...650	0.1
	-200...650	0.01
Pt100 (3923)	-200...600	0.1
	-200...600	0.01
Pt100 JIS (3916)	-200...600	0.1
	-200...600	0.01
Pt200 (385)	-200...850	0.1
	-200...850	0.01
Pt500 (385)	-200...850	0.1
	-200...530	0.01
Pt1000 (385)	-200...850	0.1
	-200...850	0.01
Pt1000 (3916)	-200...850	0.1
	-200...850	0.01
Ni100 (617)	-60...180	0.1
	-60...180	0.01
Ni120 (672)	0...150	0.1
	0...150	0.01
Cu10 (42)	-70...150	0.1
	-70...150	0.01
Cu100	-180...150	0.1
	-180...150	0.01

Table 6 – Thermoresistance simulation table



Fast programming of the value to be simulated

In generation or simulation on any particular channel the simulated value can be rapidly changed by pressing immediately to the right of the simulated value. By pressing the displayed value a virtual numerical keyboard appears.

6.4 User Interface

The Pascal 100 or Pascal 100/IS calibrator has a wide display with touch screen through which it is possible to set up the instrument.

The 1-, 2- or 3-window display mode shows a right column containing the following information:

- Ambient temperature
- Barometric pressure
- Relative humidity
- Battery charge status – power supply
- Data Logger status
- Date
- Time
- Keys for channel/instrument/global functions

The following figure shows the typical display of the calibrator.

NOTE: some keys include a white semi-triangle symbol on the bottom right side: it indicates that the button has different function. It allows to activate 2 different actions, depending on the short or long pressing of the button itself.

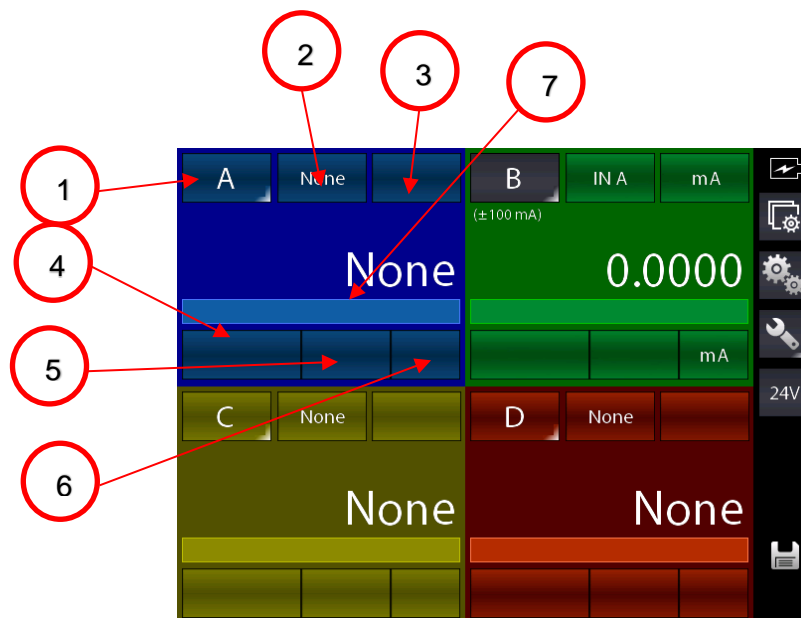



Figure 13 – Typical display of Pascal 100 or Pascal 100/IS with 4 windows

The display shows up to four windows (channels) that can be switched from one to four by using

the button : Each windows can be also assigned to a different channel, related to its functional module, and according to the user requirement.

The description for the 7 available areas are as follows:

1. Key for Selection / Assignment of the channel letter to the active window
2. Key for selecting the source for module IN / OUT / P / Key
3. Key for selecting the field of the selected module (where applicable)
4. Key for selecting the sub-field of the selected module (where applicable)
5. Key for selecting the field options of the selected module (where applicable), i.e. Tc or Rtd type
6. Key for selecting the unit of the selected field (where changeable)
7. Line for display status messages when active (i.e. filter, ramp, offset, etc...).

The picture above shows the calibrator set for current signal generation (0-20 mA) with values indicated on the channel B window. The other channels are not configured.

GB

The column on the right that appears with the 4-window display mode shows the basic information and always shows 4 buttons for the following functions:

1. Channel settings
2. Instruments functions
3. General settings
4. Enable/Disable P.S. 24 V DC

Compared to the display mode for one single channel, the 1- or 2-window display mode shows additional information as follows:

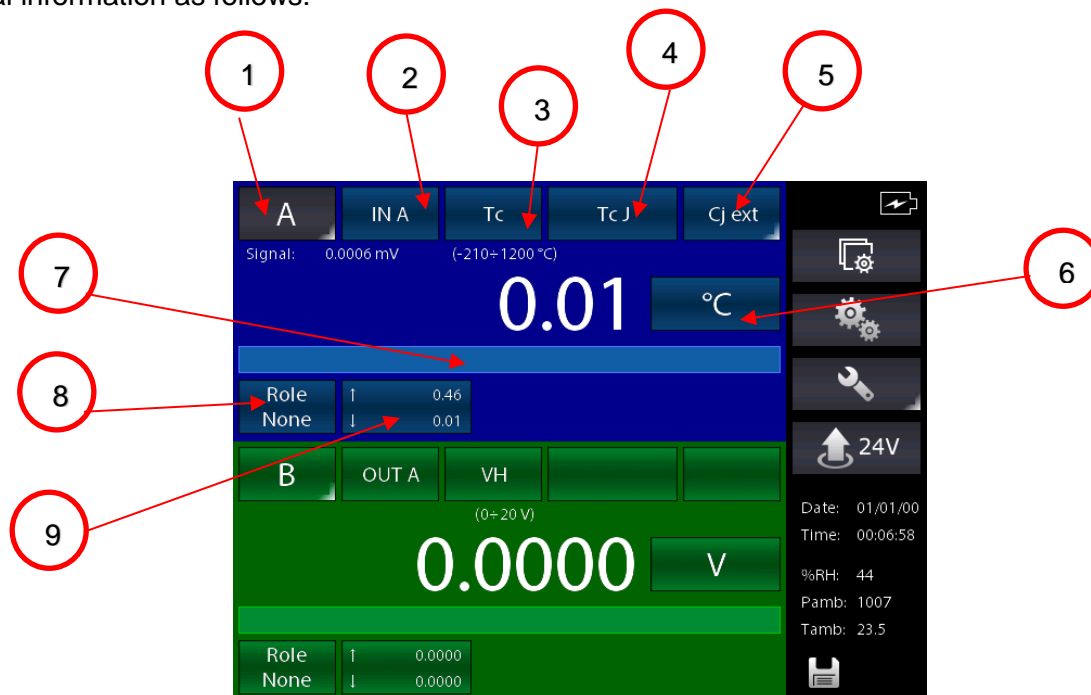


Figure 14 – Typical display of Pascal 100 or Pascal 100/IS with 4 windows

8. Selection of the Channel Role (None, REF, DST)
9. MAX and MIN values indication. Press the button to reset data

6.4.1 Channel configuration

The assignment of a function to a software channel is a simple and intuitive procedure.

The channel assignments are very similar and independent for each channel.

The calibrator manage 4 channels identified by the letters from A to D. Each display window can shows the information of the desired channel by selecting the corresponding letter.

The following procedure shows how to configure the “**C**” **channel** on the first window and how to set up the Pascal 100 or Pascal 100/IS for temperature measurement through a Pt100 thermoresistance connected to the input pins of the IN A module (using 4 wires measurement). The selection of one of the four available channels is made by pressing the channel letter on the displays, as shown in the figure below.



Channel selection

To verify if the channel has been correctly selected it is possible to check if the button indicating the Channel Letter located in the top left corner of the corresponding Channel Window, is indicated in white on grey background or not. See figure below.

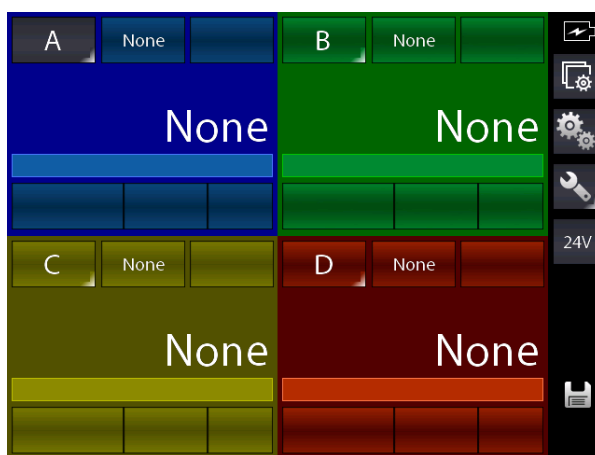


Figure 15 – Channel A selected

At first you should change the Channel Letter assignment on the first window by pressing and keeping pressed the letter button for few seconds (indicated with “Q” in the picture below) until the letter changes into “C”.

GB

By pressing the letter button quickly activates the channel: the button displays a grey background when active.

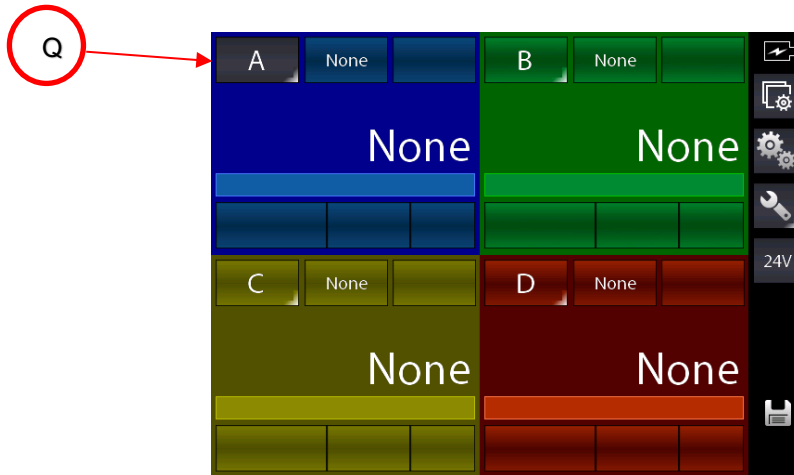


Figure 16 – Changing the Channel Letter

By pressing and keeping pressed the key Q the following screen appears:

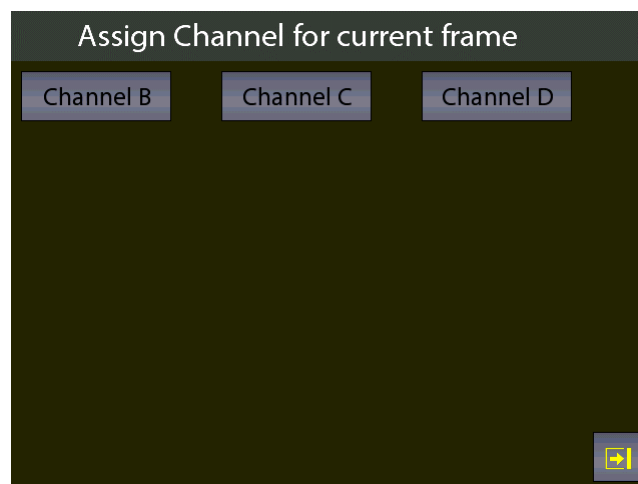


Figure 17 – Selecting the Channel Letter

Press the “Channel C” button to assign the Channel.

The screen changes as follows:

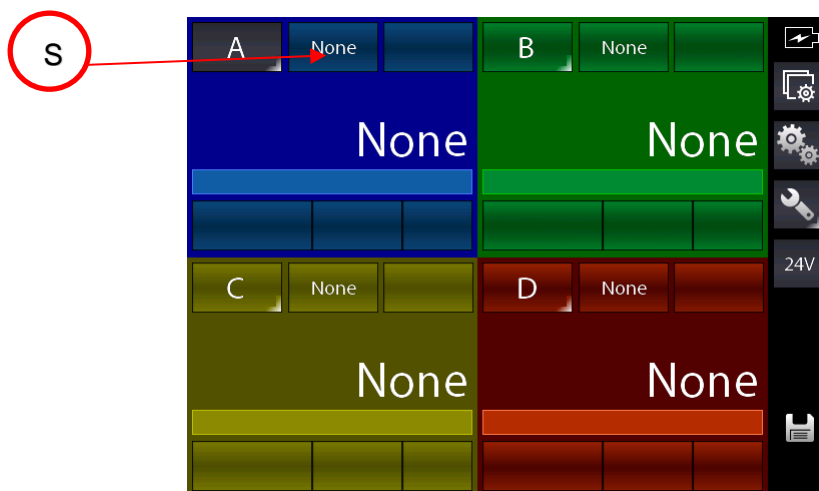


Figure 18 – First window assigned to Channel “C”

Press the key indicated with “S” to select the module for Rtd measuring. The following screen appears (depending on the installed modules):

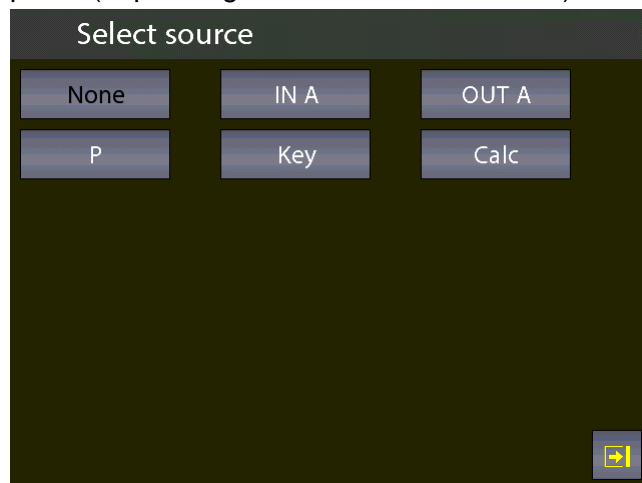


Figure 19 – Source selection

As we need to measuring from the input, select the option “IN A”: The screen will change as follows:

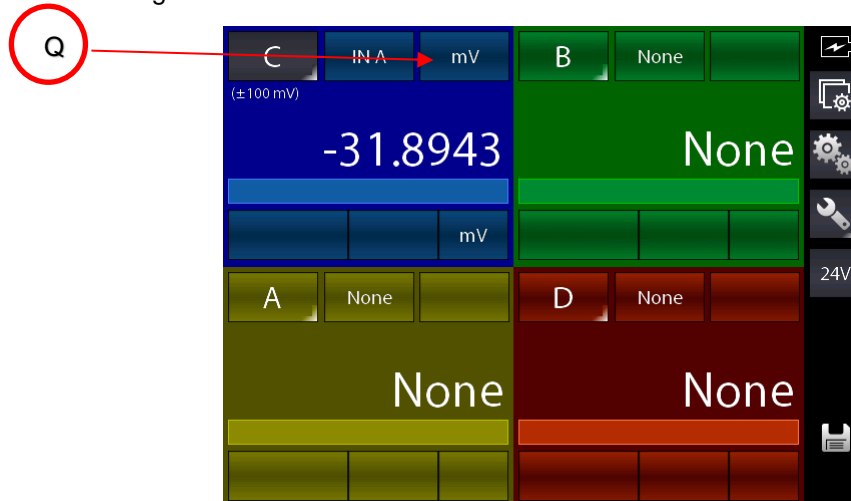


Figure 20 – IN A Selected

GB

The calibrator set the selected option and load the last used unit for the module (in this case the last used measuring unit was the mV measuring). To change the measuring unit in Rtd press the key indicated with “Q” in the figure above:

The following screen appears:

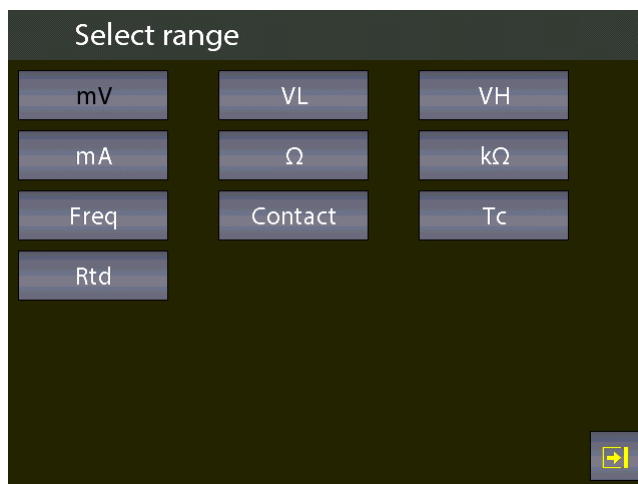


Figure 21 – Selecting the unit for module IN A

By selecting the “Rtd” unit the screen changes as follows:

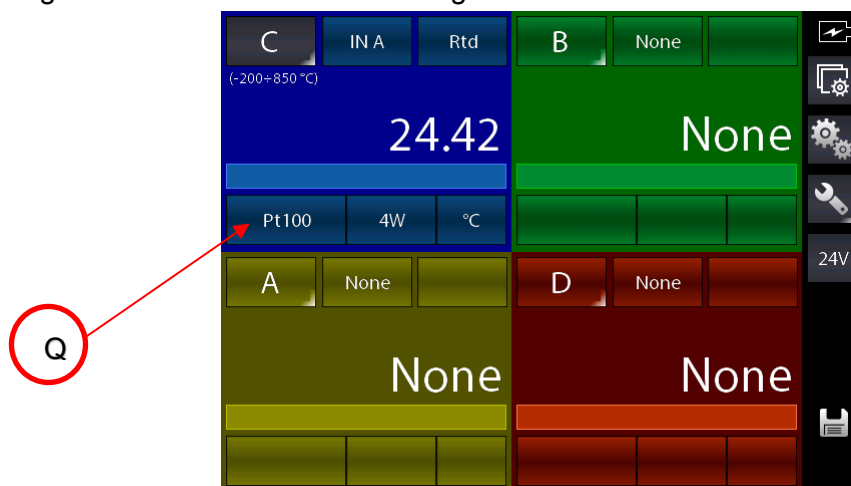


Figure 22 – Module IN A with Rtd unit selected

The calibrator set the unit in Rtd and shows the last used Rtd type (in this case the last used Rtd type was Pt100 IEC).

It is also possible select an Rtd type “User” if not listed in the pre-defined options.

To select the Rdt type “User” press the button indicated with “Q” on the figure above.

The following screen appears:

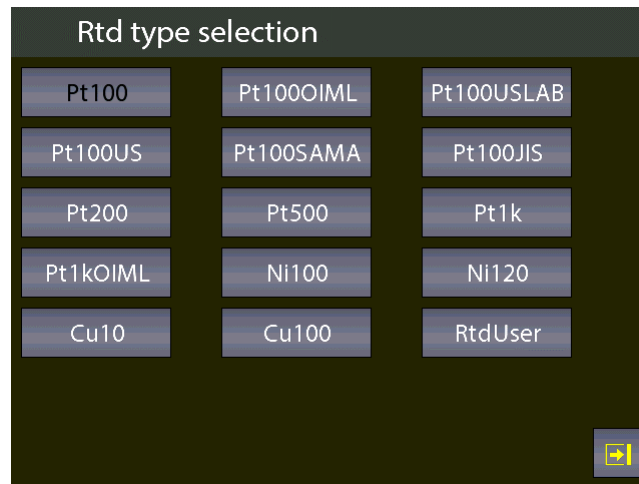


Figure 23 – Selecting the Rtd type

Press the button “RtdUser” and the screen will change as follows:

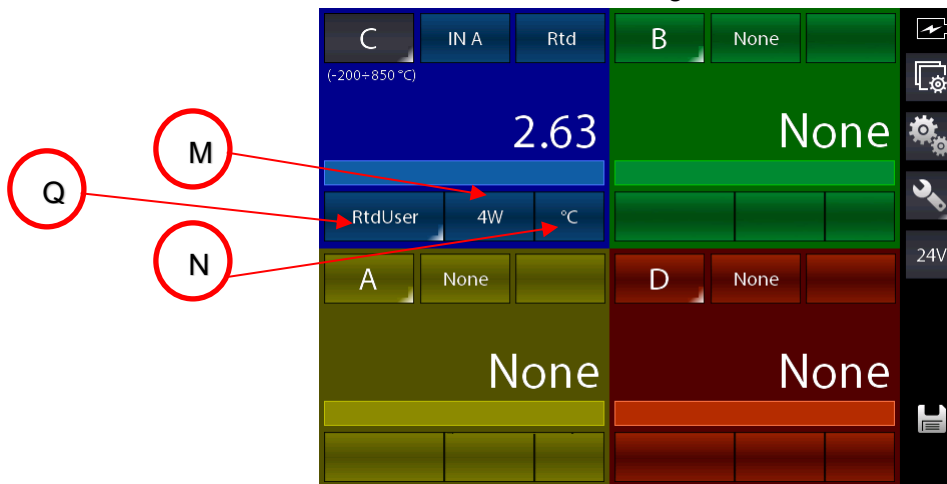


Figure 24 – IN A module with RtdUser selected

The calibrator is now set for measuring an RtdUser by using the 4-wire (4W) "IN A" input and displaying the temperature in °C.

The button indicated with “Q” in the picture above now shows a little with triangle in the right-down corner: this symbol indicated that if the button will be pressed for long time, a different function can be selected. By pressing and keep pressed that button you can enter the pages for setting the desired parameters related to the custom or user thermoresistance (Ptd).

The following screen appears:

GB

Rtd parameters setup	
A Coeff.	35.0000
B Coeff.	-5.8330
C Coeff.	-4.2060
Resistance	100.000




Figure 25 – Setting parameters for RtdUser



Measurements of RTD - 4-wire

If possible it is recommended to perform RTD measurement with four wires to eliminate parasite resistances of the connecting cables. All specifications for thermoresistance aim for four wires measurement.

RTD USER must be selected when the operator needs to measure a non-standard RTD in agreement with the following formula:

$$\text{If } T \geq 0 \text{ }^{\circ}\text{C } R(t) = R_0 * (1 + A * t + B * T^2)$$

$$\text{If } T < 0 \text{ }^{\circ}\text{C } R(t) = R_0 * (1 + A * t + B * T^2 + C * (t - 100) * t^3)$$

Where:

$$A = X * 10^{-3} \text{ }^{\circ}\text{C}^{-1}$$

$$B = X * 10^{-7} \text{ }^{\circ}\text{C}^{-2}$$

$$C = X * 10^{-12} \text{ }^{\circ}\text{C}^{-3}$$

$$R_0 = \text{Resistance @ } t = 0,01 \text{ }^{\circ}\text{C}$$

$$X = \text{Value}$$

Further specific parameters can be also configured for the already configured channel by pressing



the button

Based on the selected channel, the following screen appears:

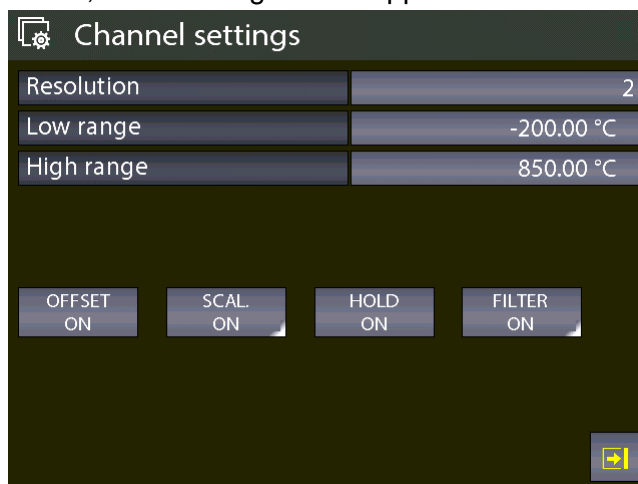


Figure 26 – Channel setting

Here, the resolution can be set by selecting the number of decimal digits and also the initial and final values of the calibration, the relationship between the configured channels as REF (REfERENCE) and DUT (DEvice Under TEST).

This data will be used in the Report function.

6.4.2 Other assignments

6.4.2.1 Pressure measurement

The following procedure illustrates the setting of Pascal 100 or Pascal 100/IS for pressure measurement. The particular channel is selected by pressing the channel letter (the background of the button changes in gray)

Then, press the button indicated with “Q” to assign the desired functional module:

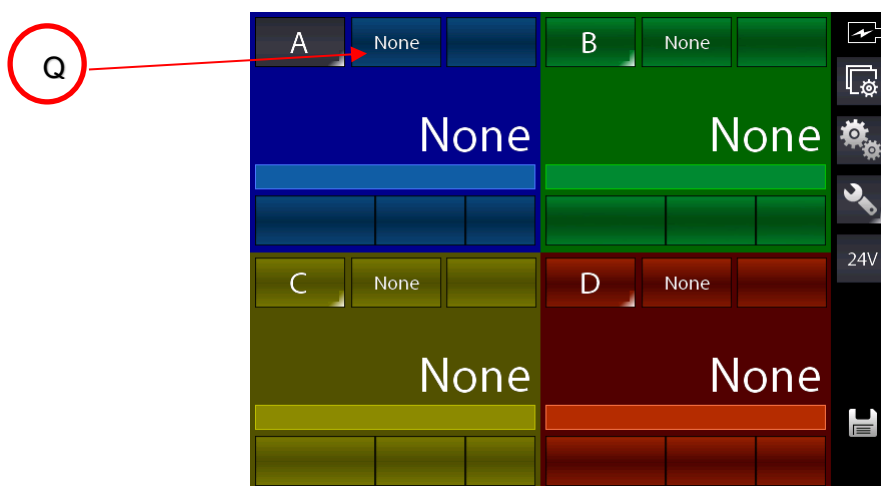


Figure 27 – Channel assign selection

The following screen appears:

GB

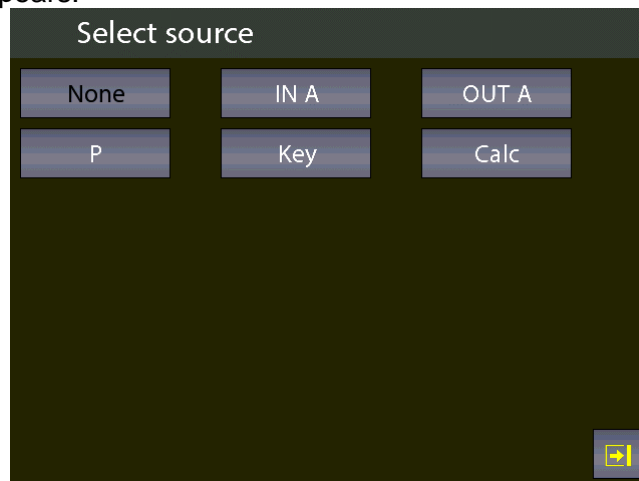


Figure 28 – Selecting the source “P”

Automatically the program shows the following screen and it remains in this position until the operator points out what type of parameter he desires to associate to a selected channel, for example to the Channel A. In this case press P for pressure.

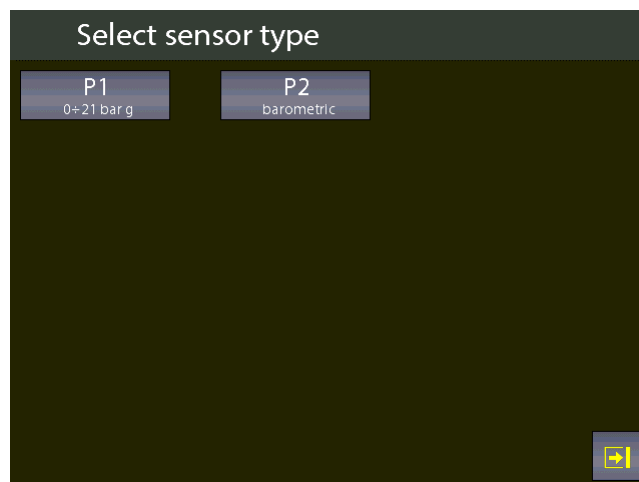


Figure 29 – Pressure parameter selection

The Pascal 100 or Pascal 100/IS can be equipped with up to two pressure modules and each of them can handle up to three pressure sensors, two internals and one external with standard accuracy.

Note: The shown list on the screen depends on the installed, mounted and connected number of sensors.

The sensor is identified by the measurement range and the measurement mode (g = gauge pressure or a = absolute pressure). This information is displayed under the writing PE-1 (first external sensor) or PE-2 (second external sensor). See the figure above as example.

When the sensor has been selected, the following screen appears:

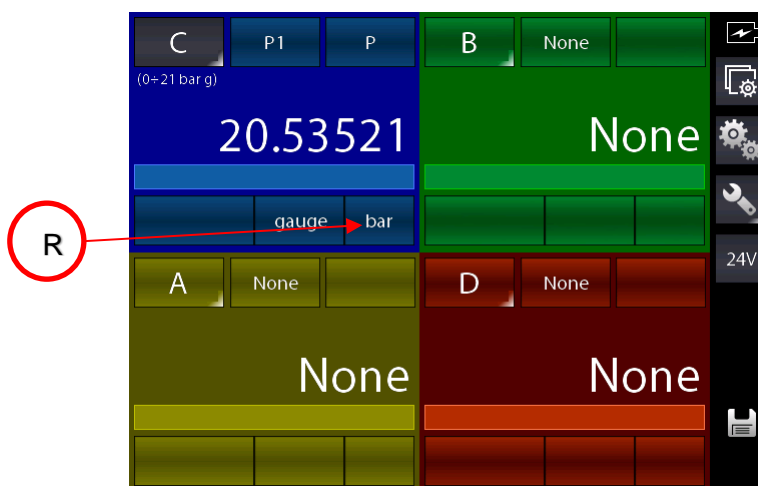


Figure 30 – Pressure sensor parameters selection

The pressure engineering unit can be changed by pressing the button indicated with “R” in the picture above.

The pressure engineering units available are:

Measure unit					
bar	mbar	ftH ₂ O@4°C	inH ₂ O@4°C	inHg@0°C	psf
psi	atm	torr	mH ₂ O@4°C	cmH ₂ O@4°C	mmH ₂ O@4°C
mHg@0°C	cmHg@0°C	mmHg@0°C	kg/m ² @g_std	kg/cm ² @g_std	MPa
kPa	hPa	Pa			

Further specific parameters can be also configured for the already configured channel by pressing



the button

Based on the selected channel the the next screen shows the Span parameter (measuring range) and his resolution. For default the sensor has its maximum range equal to the measuring range (Span). If the Span can be redefined, or to be reduced, the same can be changed by using a numeric keyboard. The redefinition of the Span is used during a calibration for comparison where a relationship between a REF and a DUT channel has to be done. The resolution can also be changed based on the desired number of decimal digits (related to the selected engineering unit):

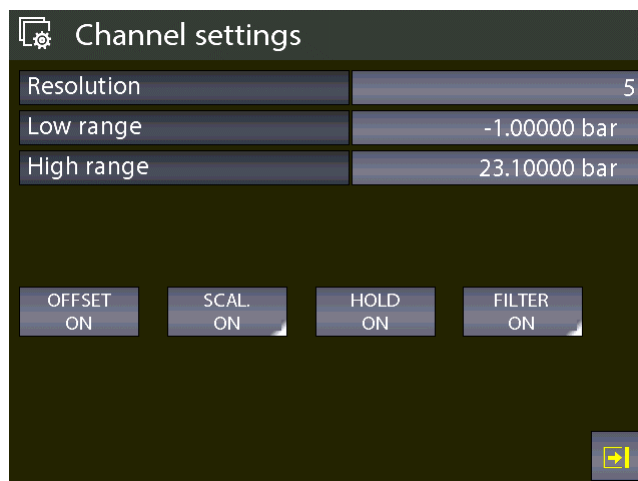


Figure 31 – Sensor range setup

GB

6.4.2.2 Thermocouple signal measurement

The following procedure shows the setup of Pascal 100 or Pascal 100/IS for temperature signal measurement, for example, through a thermocouple connected to the IN (input) module.

The particular channel is selected by pressing the channel letter (the background of the button changes in gray)

Then, press the button indicated with “Q” to assign the desired functional module:

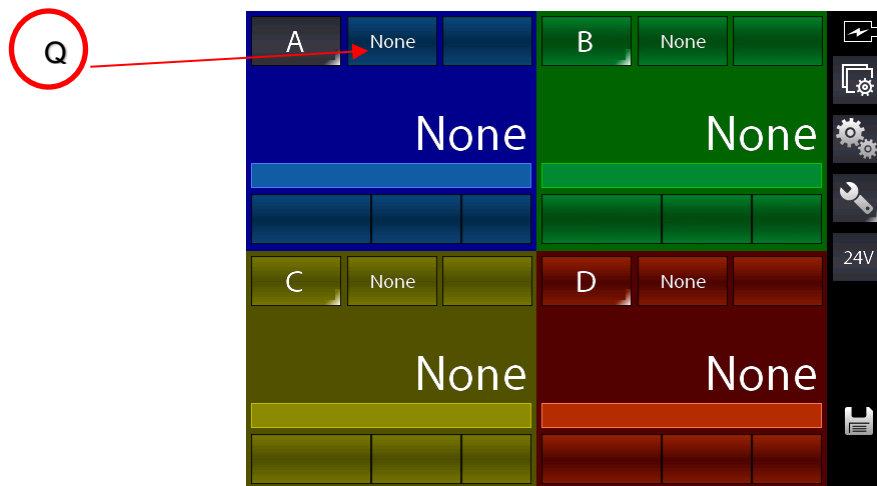


Figure 32 – Channel assign selection

The following screen appears:

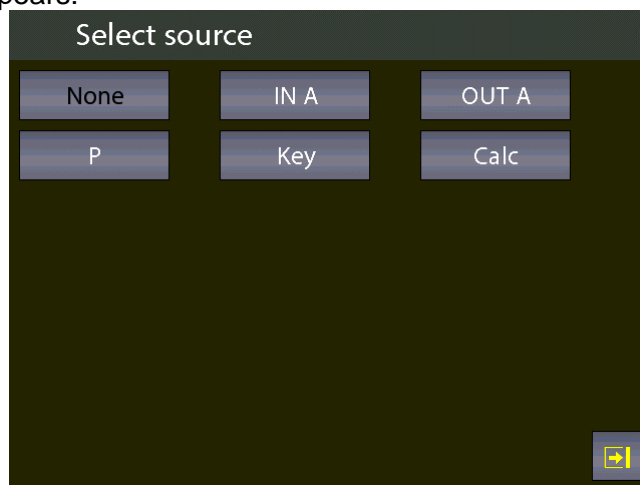


Figure 33 – Selecting source “IN A”

Automatically the program shows the following screen and it remains in this position until the operator points out what type of parameter he desires to associate to a selected channel, for example to the Channel A. In this case press the button “IN A” to measuring from the input.

The main screen changes as follows:

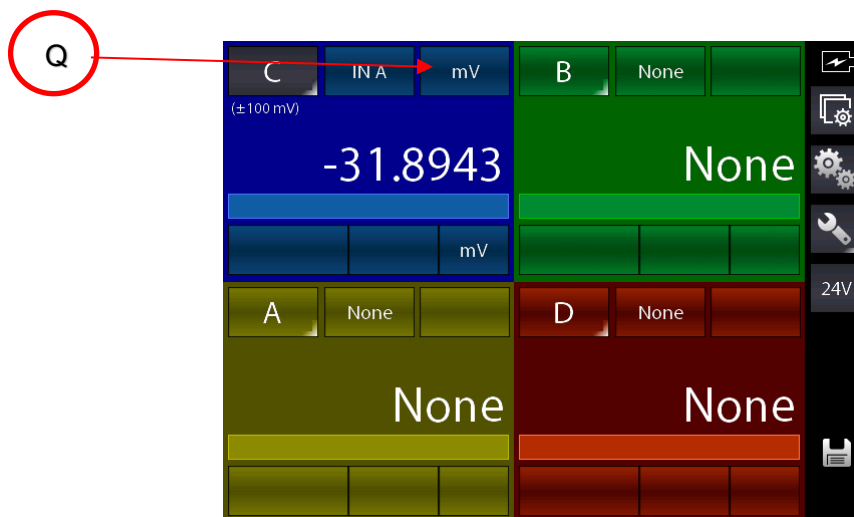


Figure 34 – “IN A” Selected

The calibrator is now set on the “IN A” module, and it select the last used unit for this module (in this case the last used unit was “mV”). Press the button indicated with “Q” to change the unit from mV to **Tc** and the following screen appears:

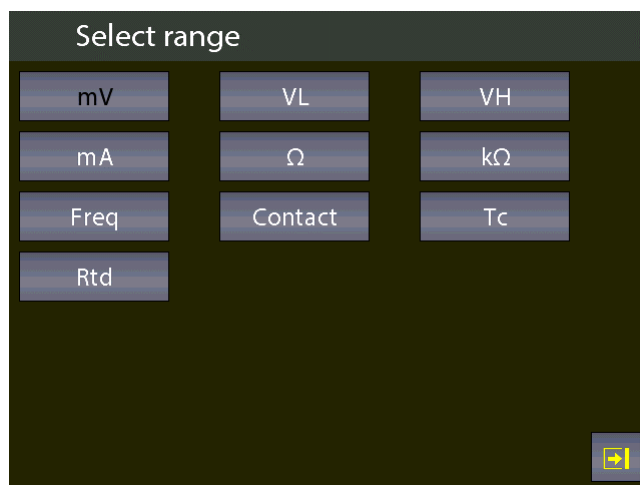


Figure 35 – Selecting the unit “Tc” for the module “IN A”

Press the button “Tc” and the main screen changes as follows:

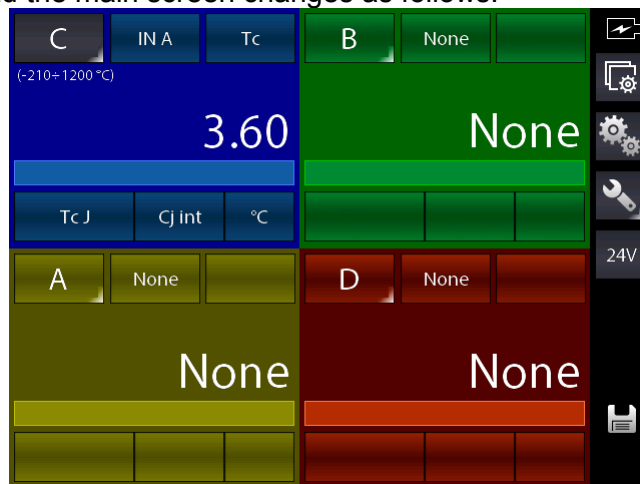


Figure 36 – Module “IN A” with unit “Tc” selected

The calibrator is now set for measuring “Tc”, and it select the last thermocouple type used (in this case the last thermocouple type used was Tc, Type J with internal cold junction (active) and temperature shown in °C.

GB

Selecting “internal cold junction”, a Pt100 is directly connected to the TC input pins, measures the environmental temperature; whereas by selecting “external cold junction”, the temperature value must be inserted by using the keyboard.

Press “R” first in order to change the Cj type into external Cj type (E), then keep pressed the button “R” (a semi triangle symbol on the bottom right corner of the button “R” appears”:

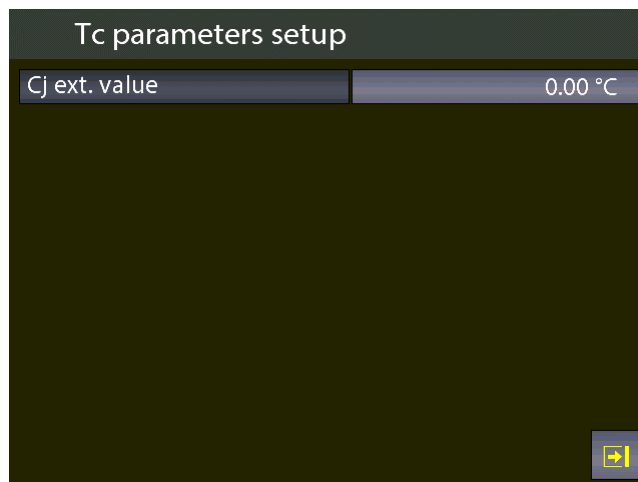


Figure 37 – Tc parameters selection: External Jc type (manual)

6.4.2.3 Electrical parameter measurement

The following procedure shows the settings of Pascal 100 or Pascal 100/IS for the electrical parameters measurement through the input module.

The particular channel is selected by pressing the channel letter (the background of the button changes in gray)

Then, press the button indicated with “Q” to assign the desired functional module:

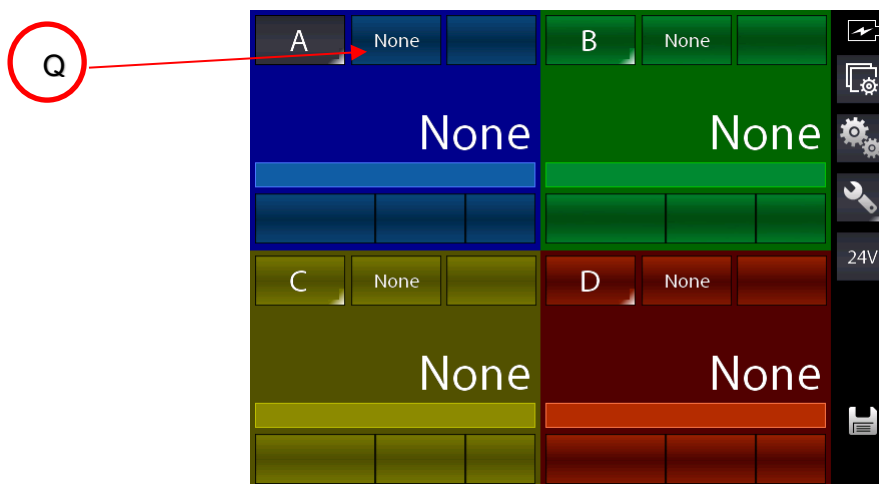


Figure 38 – Channel assign selection

The following screen appears:

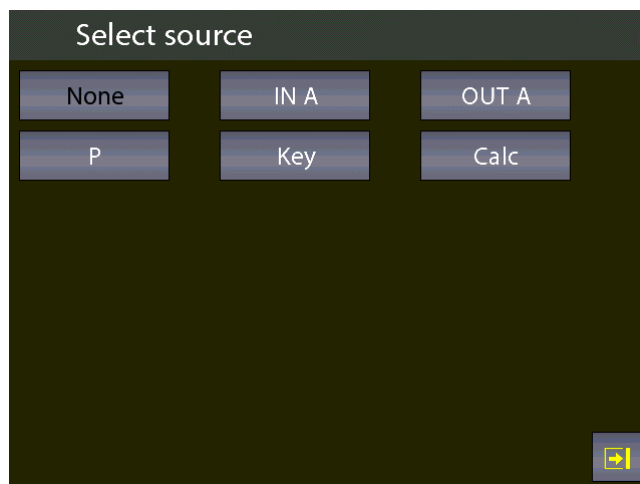


Figure 39 – Selecting the source “IN A”

Automatically the program shows the following screen and it remains in this position until the operator points out what type of parameter he desires to associate to a selected channel, for example to the Channel A. In this case press “IN A” for measuring from the input.

The main screen changes as follows:

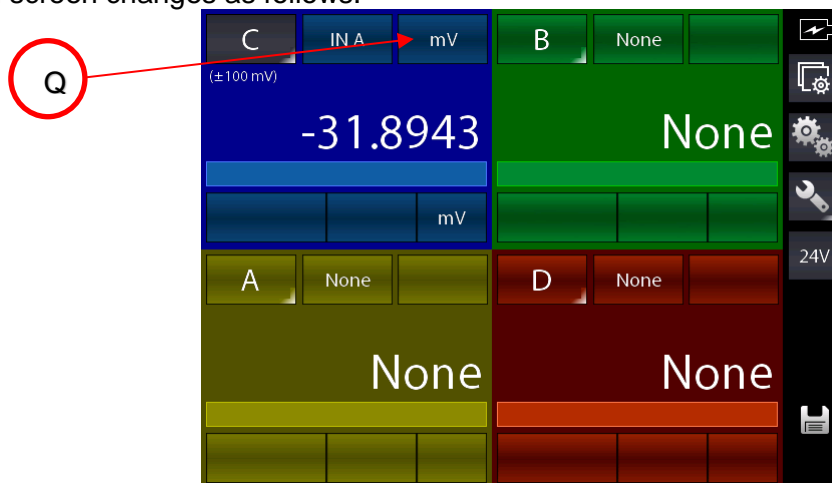


Figure 40 – Source “IN A” as first selection

The calibrator is now set on the “IN A” module, and it select the last used unit for this module (in this case the last used unit was “mV”). Press the button indicated with “Q” to change the unit from mV to **Tc** and the following screen appears:

GB

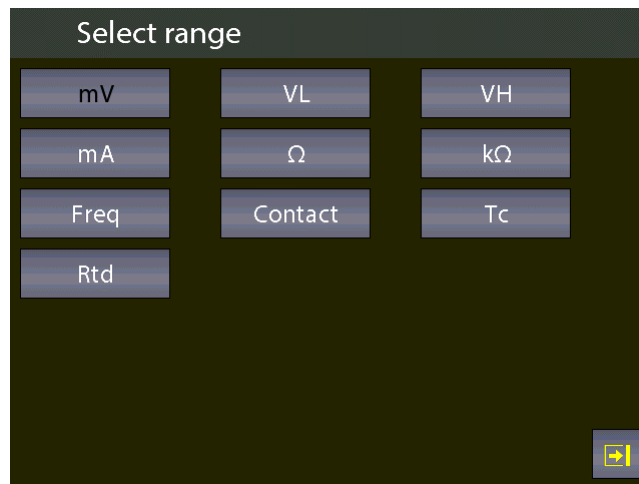


Figure 41 – Selecting “mA” unit for module “IN A”

By selecting the unit **mA** the following screen appears:

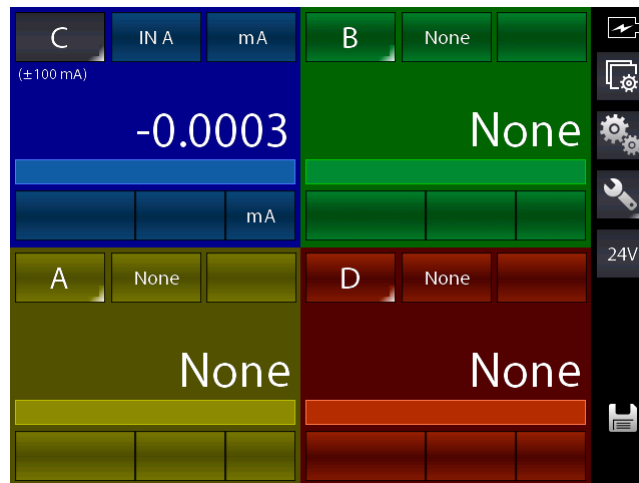


Figure 42 – Unit “mA” selected for module “IN A”

6.4.2.4 Temperature Simulation

The procedure for the temperature simulation assignment is similar to the measurement one as described previously, except for the step where the operator needs to select operative module by pressing the button indicated with “Q”:

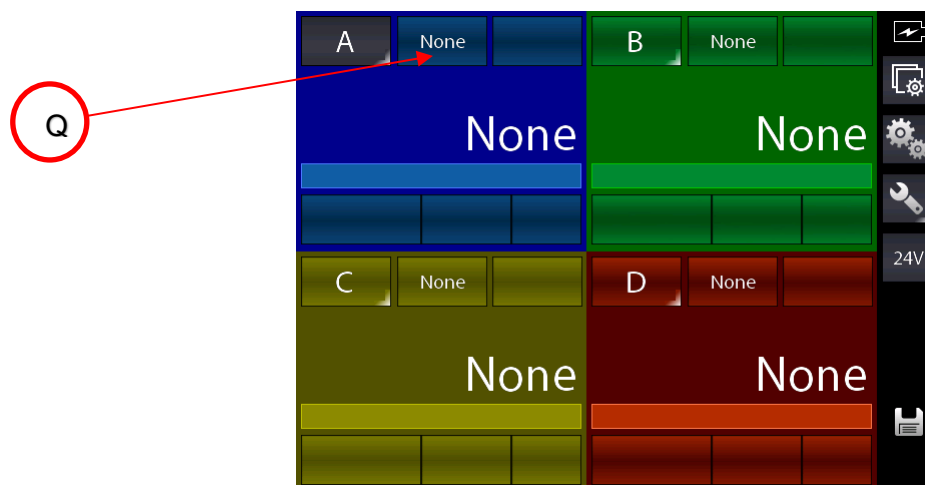


Figure 43 – Selecting channel assignment OUT A - mA

The next step is the selection of one of the output modules OUT A or OUT B (if present):



Figure 44 – Selecting generation module (OUT A or OUT B)

6.4.2.5 Electrical parameter generation

The procedure for the assignment of the generation of an electric parameter (for example mA) is similar to the electrical signal measurement one as described previously, except for the step where the operator needs to select operative module by pressing the button indicated with “Q”.

In this case the option OUT A or OUT B should be selected.

From the main screen, now the loop type must be selected between: passive (the calibrator Pascal supply the current loop) or active (current loop supplied externally):

GB



Figure 45 – Setting the mA-loop generation

6.4.2.6 Channel C or D – mathematic functions

Channel C or D has an additional setting named CALC. This function enables to display on channel n. C or D a value, result of the combination of the values displayed in channel **A** and **B**. To access, select the channel C, or D, then the button for selecting the source:

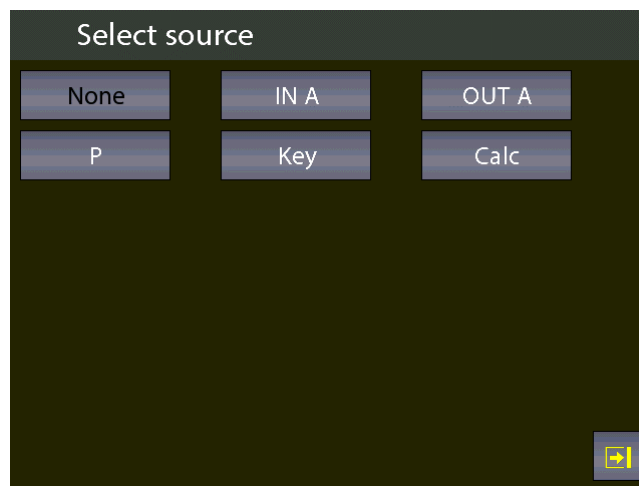


Figure 46 – Selecting module Calc

Pressing CALC the followings screen is displayed:

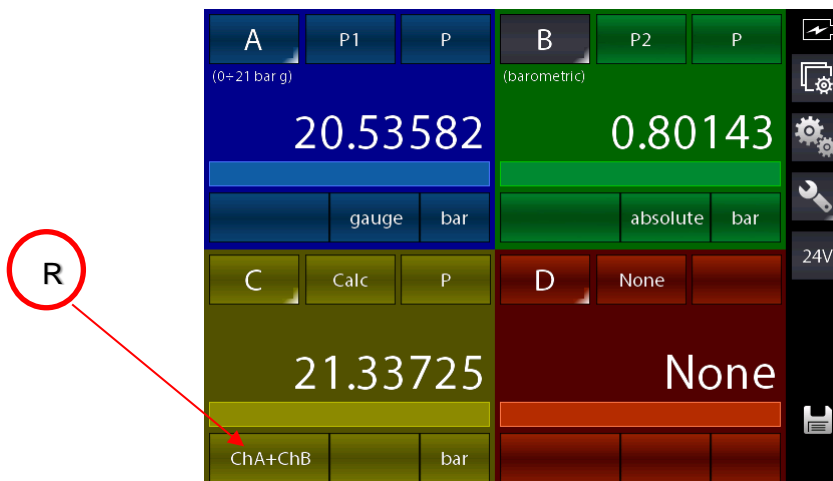


Figure 47 – Selecting assignment of channel Calc

The calibrator is now set for the module CALC and it preset the last used calculation type for this module (in this case the last used calculation type was ChA+ChB).

Press the button indicated with “R” in the picture above to select another calculation type.

GB

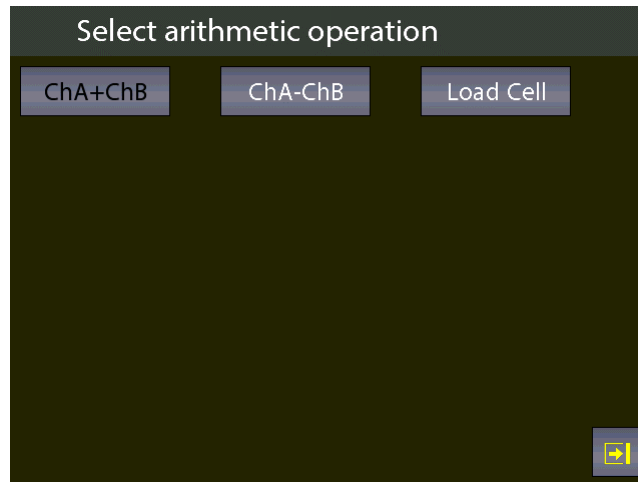


Figure 48 – Types of calculation

Here you can find:

- CHA + CHB** channel 4 or C displays the total value of the values displayed on channel A and B
- CHA - CHB** channel 4 displays the difference value of the values displayed on channel A and B
- Cell Load** channel 4 or D4 displays the ratio mV/V of the load cells

CHA+CHB and CHA-CHB functions can be used only if channel A and B are set with the same values: same engineering unit, same number of digits, no channel assigned with error indication. Otherwise the channel 4 will be displayed as:

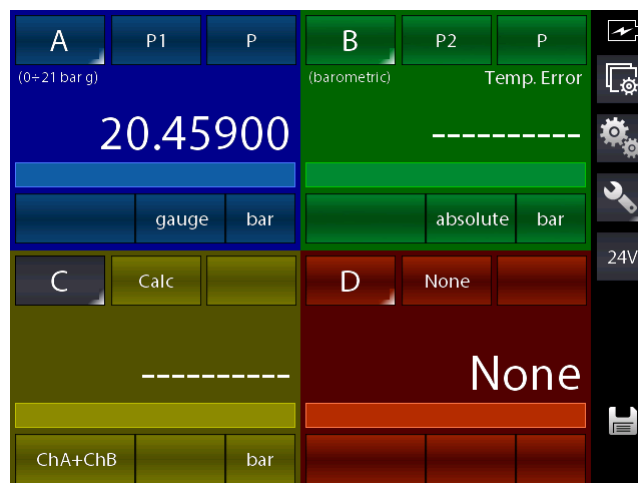


Figure 49 - Calculation non possible for the Channel 4

For the Cell Load, the channel 4C or D can calculate the result coming from a load cell connected as per the below scheme:

GB

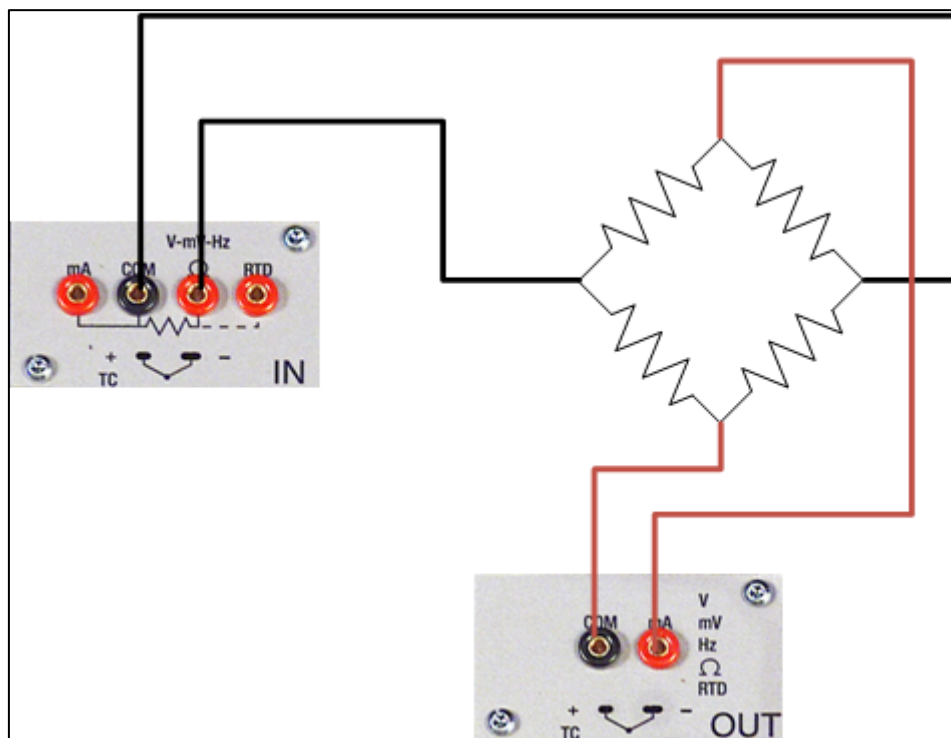


Figure 50 – Cell Load connection

Calculation is possible only when channel A is assigned for mV measurement (bridge signal) and channel B is assigned for V generation, range 0÷20 V (bridge supply). Moreover channel A should not be set in error mode.

In this case, below what will be displayed:

GB

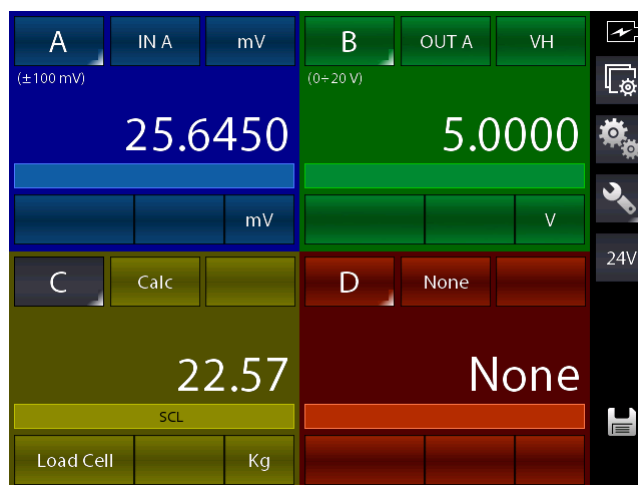



Figure 51 – Cell Load calculation

Pascal 100 or Pascal 100/IS allows to manage the sensitivity of the load cell from 0 mV/V up to 9.99999 mV/V.

Moreover, on channel 4C or D, the SCALING function can be assigned through the menu

CHANNEL SETTINGS (button ) in order to display an engineering unit more appropriate (for example Kg or a pressure unit).

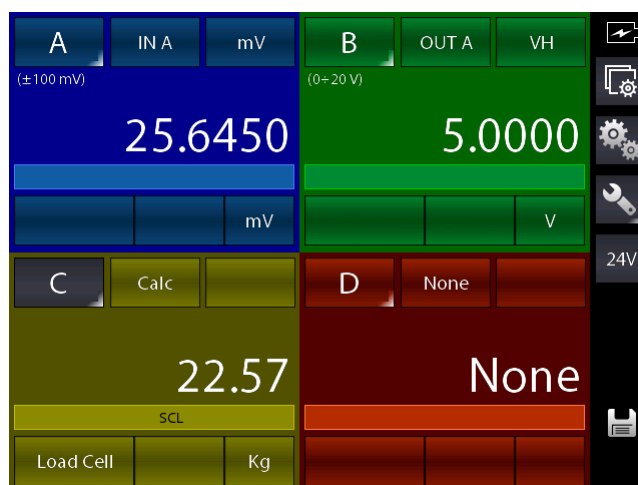


Figure 52 – Cell Load calculation with Scaling function active

6.4.2.7 HART channel assignment

To select the channel press on one of the four large displays, then press CHANNEL. Once menu is displayed press ASSIGN. Procedure is shown below:

GB

The particular channel is selected by pressing the channel letter (the background of the button changes in gray)

Then, press the button indicated with “Q” to assign the desired functional module:

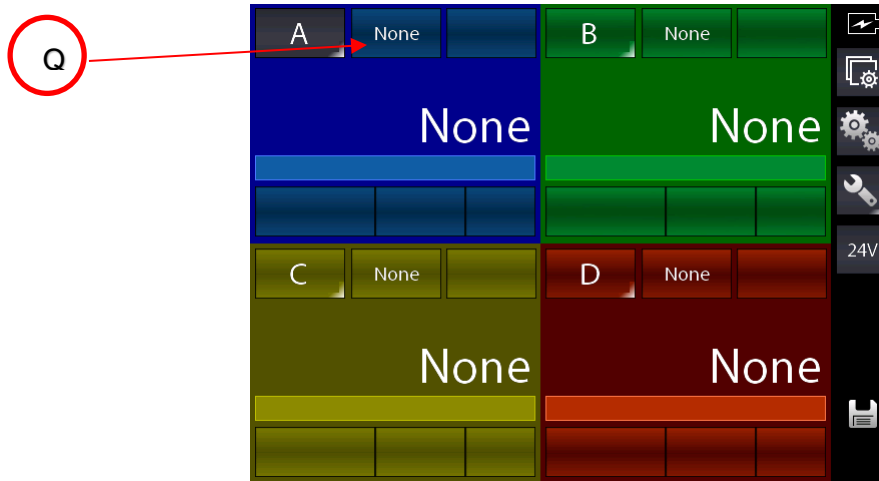


Figure 53 – HART Channel assign selection

The following screen appears:

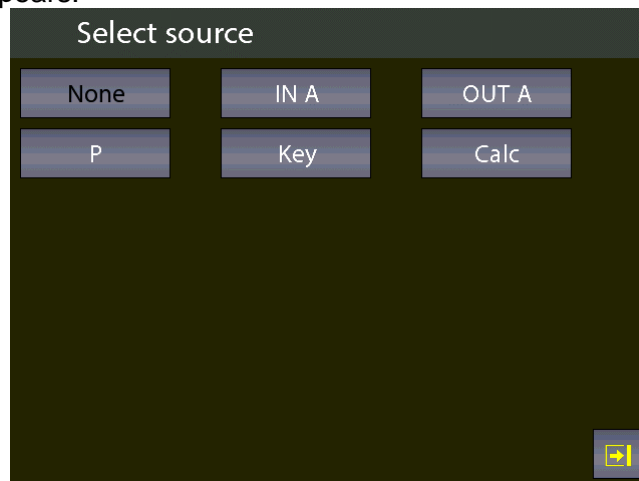


Figure 54 – Selecting the source “HART”

Select HART for HART measurement:

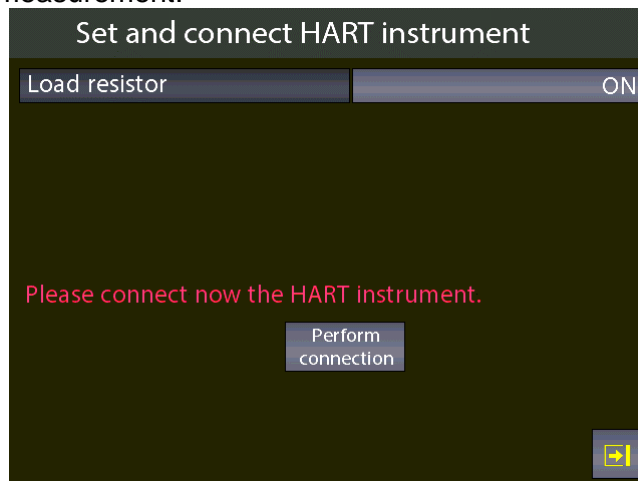


Figure 55 – Connecting a HART device

Here the user can choose if enable the internal module 250Ω resistor (ON or OFF), needful for HART communication (it can be connected externally or can be supplied by the calibrator).

Before pressing “**Perform connection**” be sure to already make the proper connections to the HART instrument

Press “**Perform connection**” and, after few seconds, if no error is shown the following main screen appears:

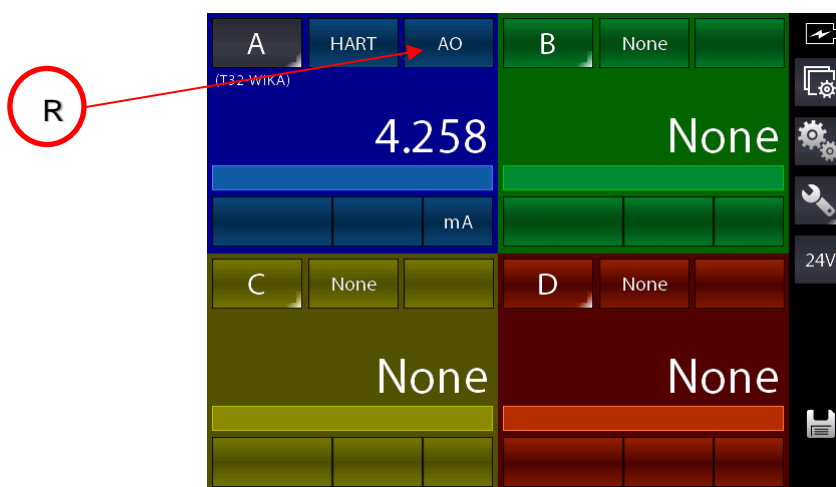


Figure 56 –HART channel assigned

The main screen shows the HART AO (Analogic Output) value.

Press the button indicated with “R” to display the PV (primary variable) parameter.

Here the user has the possibility to change some HART parameters:

- Select the channel with active HART communication (in this case the channel A)
- Push the button Channel Settings  to open the following screen:

GB

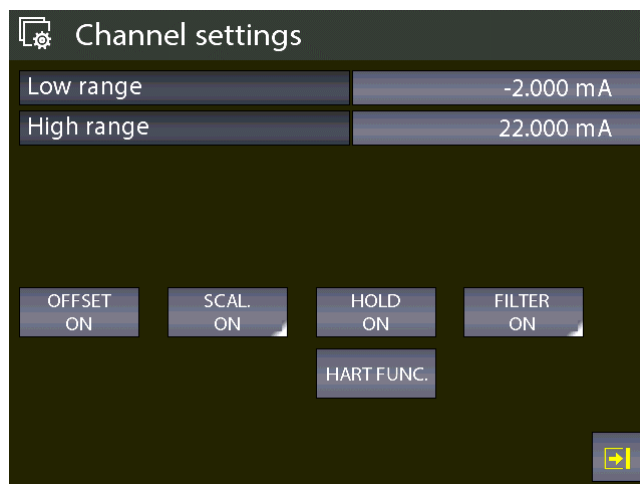


Figure 57 – Setting the HART channel

Push the button “HART FUNC” and the following screen appears:

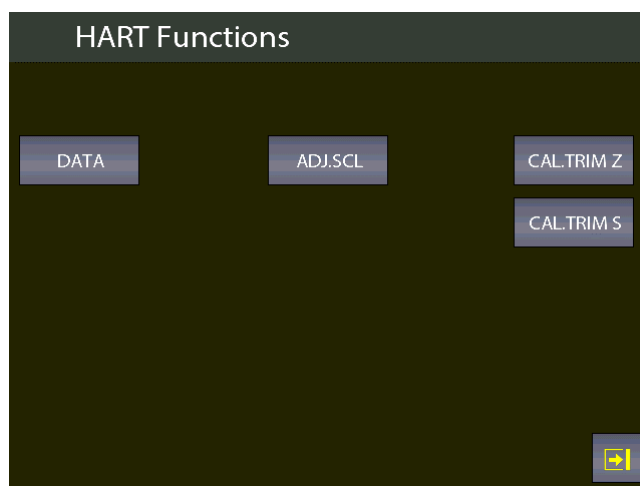


Figure 58 – HART function screen

Push the button “DATA” to display the HART data:

HART data	
Tag:	T32-WIKA
Descriptor:	DEMO UNIV
S/N	848823
Manufacturer	Wika
PV Decimals num.:	5
Low scale value	-203.32998 °C
High scale value	863.00000 °C
PV LRV:	23.15973 °C
PV URV:	110.00000 °C
	▼

Figure 59 – HART data display

Here the user has the possibility to change some parameter by pushing on the value on the right side of the screen (the ones shown with ‘:’ the arrows at the bottom of the screen display further parameters).

They changeable parameters can be: TAG, DESCRIPTOR, PV decimals units, PV LRV and PV URV.

Press, for example, the button for the TAG value: the following screen appears:



If desired delete all the characters with backspace and insert the desired. After press ENTER to store the parameter inside the HART transmitter; the Pascal will return to the previous display.

IMPORTANT NOTE: HART requires that all the characters must be in upper case in order to be properly stored.

6.4.2.8 HART trimmer calibration

When the HART transmitter needs to be recalibrated or adjusted the HART screen shows two types of possibilities:

- ADJ.SCL
- CAL.TRIM (Z,S)

With CAL.TRIM user can correct the analog mA generation, of the HART transmitter, referred to the digital AO value displayed if the output DAC goes out of tolerance.


Zero and Span needs to be corrected.

If the user wants to recalibrate the Trim. an INPUT mA measurement channel has to configured as REF channel. In addition, the loop wiring needs to flow to the IN mA terminals.

If no REF mA Input channel is configured first an error will be shown.

From the following screen:

GB

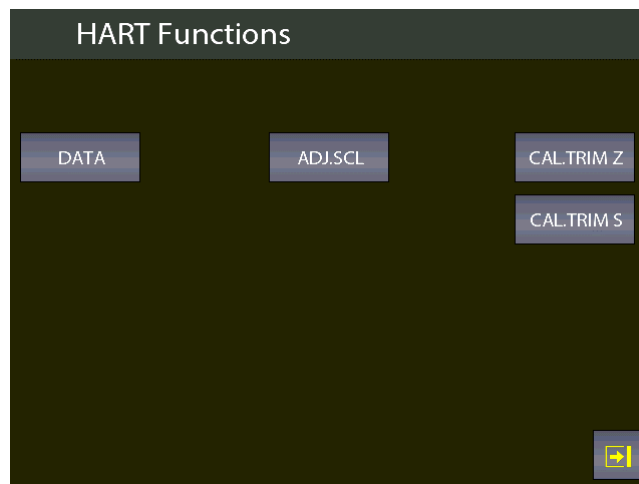

Select, for example, the “CAL.TRIM S” button:



The HART instrument is put in fixed mode generation (4 or 20 mA) and the REF channel is measuring the true analog mA generation. To re-align to the correct 20 mA (or 4 mA) generation press “CALIBR.” button.

If needed follow the same procedure for “Zero Trim”.

6.4.2.9 HART scale adjust

ADJ.SCL permits to align the range of PV to the Lower and Upper mA generation values. The Lower value of PV is the value at which the transmitter will generate the 4 mA nominal value, and the Upper value is the value at which the transmitter will generate the 20 mA nominal value. Here is described the “automated” procedure that permits to align in “real-time” these values. The user can also change them manually in the “HART data” page as seen before. If the user wants to adjust the scale a channel of the same input type of the transmitter has to be configured as REF channel. If no REF channel is configured first an error will be shown.

Press ADJ.SCL menu and the following is shown (assuming that we are using a Pt100 transmitter, the REF simulation Pt100 channel is configured as Channel B):



Set the REF Channel to the desired value that permits to output by the transmitter the 4mA value (example 20°C). When the value is stable press ADJ. LRV button.


Now set the REF Channel to the desired value that permits to output the transmitter the 20mA value (example 150°C). When the value is stable press ADJ. URV button.

Now the transmitter will generate 4 and 20 mA between 20 °C – 150 °C.

6.5 Setting channel, function, instrument

All settings can be performed by using the first three buttons on the right side of the main screen from the top to the bottom:


GB

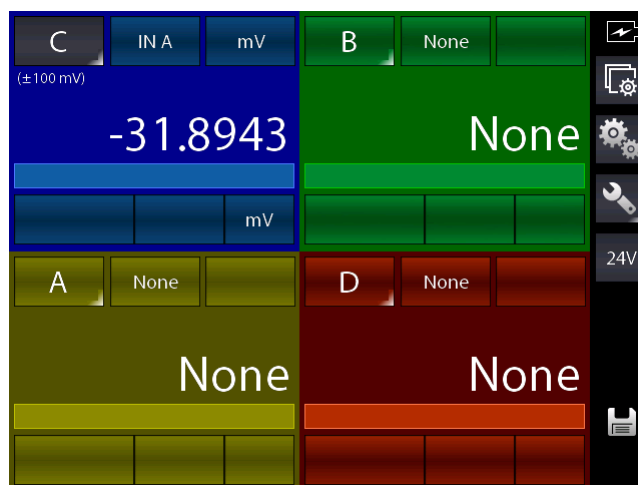

Channel setting



 Function setting



Instrument setting (press and key pressed for some seconds this key to enter the status page)



Switching button: it enable/disable the 24 V DC current supply for external instrumentation

6.5.1 Channel setting

A dedicated screen allows to configure the instrument channel: this screen contains dynamic elements, so they can differ depending on the module of the channel. If, for example, the channel is configured for thermoresistance measurements, by pressing the button “Chanel setting” the screen could be show the following parameters:

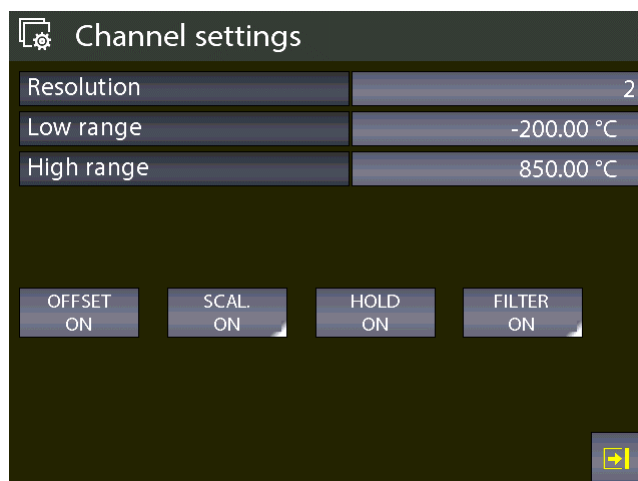


Figure 65 – “IN” Channel setting

It consists of:

SCALING ON/OFF	to enable/disable the scale function and display it with a different engineering unit. The parameters of the proportional value can be shown by keeping pressed this button.
FILTER ON/OFF	to enable/disable the user noise filter on the signal. The parameters of the filter value can be shown by keeping pressed this button.
HOLD. ON	to hold the last display (HOLD function)
OFFSET. ON	to set the zero for the measurement
RESOLUTION	to set the number of decimal digits to display
LOW/HIGH RANGE	to set the reference values of the low and high ranges when channel mode REF and DUT are uses

By entering the settings for an output channel, the same screen shows other functions for that channel:

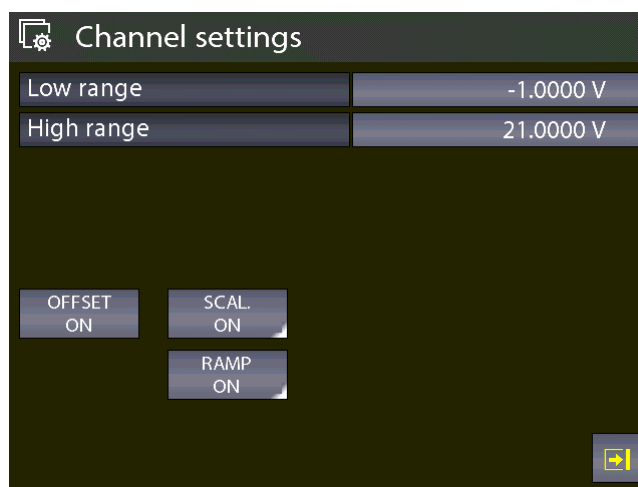


Figure 66 – Setting output channel parameters

The RAMP function can be enabled as output channel (generation). It works in the following way:

The RAMP button appears for the selected channel if it has been assigned to an output board.

With this function the user can program a ramp by automatically shifting the generation value in configurable steps.

If both the 2 generation board are installed, and they are been assigned to two different channels, a different ramp for each output can be programmed.

The programmable ramp follows the following profile:

GB

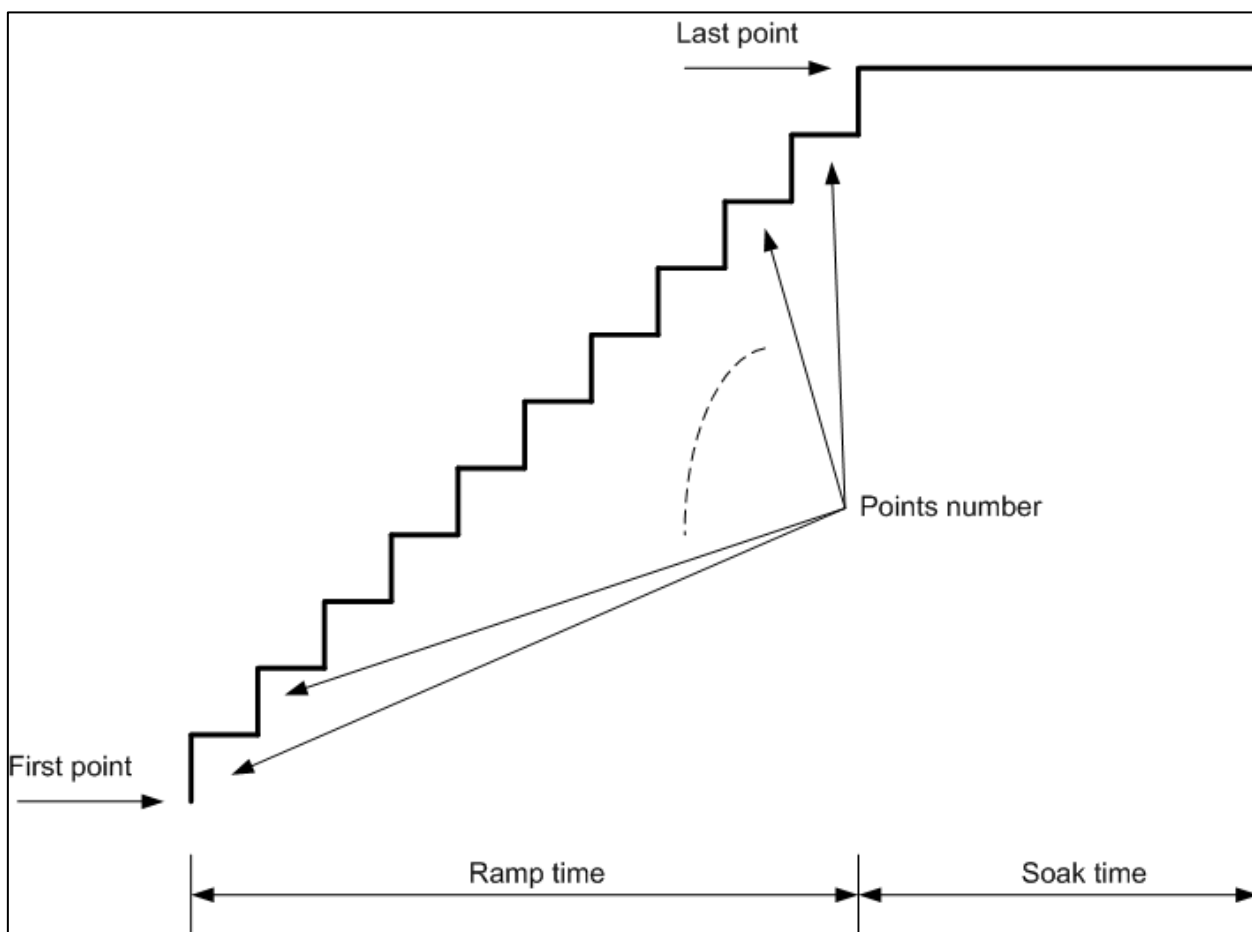


Figure 67 – Ramp profile

Keep pressed the button “RAMP ON” to set the ramp parameters:

Ramp parameters setup	
Step mode	auto-up
Cycles num.	2
N. Points	11
First point	0.0000 V
Last point	10.0000 V
Ramp time	00:00:20
Soak time	00:00:05

Figure 68 – Setting ramp parameters

The screen above shows a ramp with low range of 0 V, the value reach the high range of 10 V in 11 steps and after 20 seconds, and the ramp runs for 2 cycles.

Go back to the previous screen and press the button “RAMP ON” shortly to run the ramp function: the calibrator will show the main screen and on the output channel the indication “ramp” will appears (ramp active on channel B).



Figure 69 – Ramp function active



More Information about the Channel Menu is available in chapter 6.6

6.5.2 Functions setting

This screen is used to setting the calibrator function: The screen is as follows:

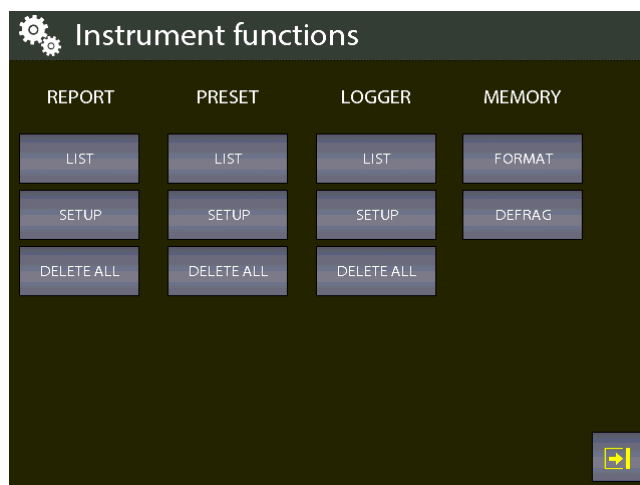


Figure 70 – Functions setting

Here the user can set different functions grouped by:

REPORT
PRESET
LOGGER
MEMORY

REPORT section:

This section is intended for the reports management.



For detailed information see chapter 6.7

PRESET section:

This section is intended for the presets management.



For detailed information see chapter 6.7

LOGGER section:

This section is intended for the datalogger management.



For detailed information see chapter 6.8

MEMORY section:

The data regarding the report, the datalogger and the presets are stored in the internal memory of the instrument. It is a virtual memory, the same as the files saved on a computer.

The MEMORY section provides 2 different selections:

FORMAT: it deletes the memory completely and it is reset to the company default. This option will delete ALL the above mentioned data, but a confirmation message will appear before executing the command.

DEFRAG: This function can be useful if a lot of data are saved and deleted frequently. In this case some not used black spaces could be created in the memory and a message for insufficient space for storing new data could be displayed. The Defrag function can be used to recover that not used space; the saved data WILL NOT be deleted but a certain time should be necessary to complete the process.

6.5.3 Instrument setting

This menu enables to see and change the settings of the instrument.

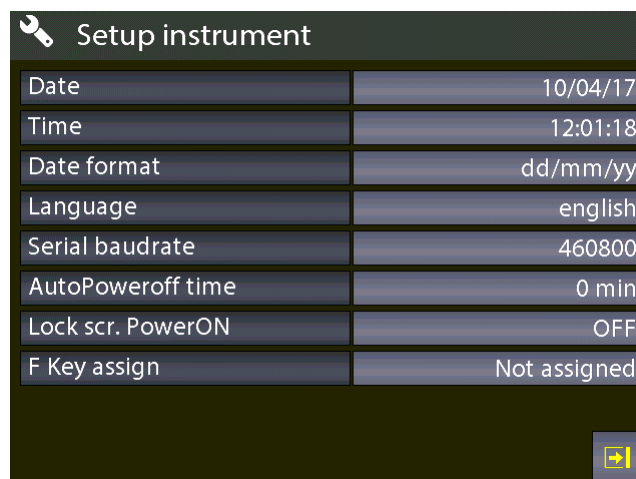


Figure 71 – Instrument setting screen

6.5.3.1 Setting the “F” key of the keyboard

The last function displayed in the picture above can be set.

Push the button at the right side close to the field “F key assign”.

Each option is active only from the main screen, if the calibration is not currently performing a report or an HART adjustment.

The following screen appears:

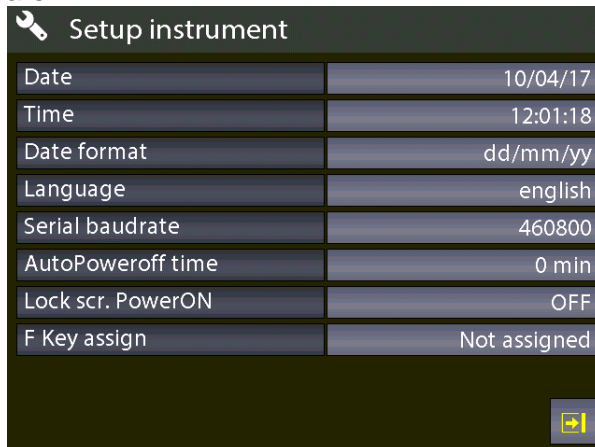


Figure 72 – Setting the “F” key

The available options are:




Figure 73 – F Key assignment

Hold All ON/OFF: press the F key to enable/disable the HOLD function on all active measuring channels.

Recall Report list: press the F key load the list of the saved reports

Recall Preset list: press the F key load the list of the saved presets

GB

The status page for the calibration can be displayed by pressing the button  on the main screen: the following information are displayed:

Instrument status page	
Model:	PASCAL100/IS-IOHP2
S/N	65034
Ver. MASTER:	4.00.03
Ver. KERNEL:	1.00.03
Ver. LCD:	1.00.03
RH-T-P S/N:	1
Battery voltage:	5.44 V
Usage time:	00000d:33h:01m

Figure 74 – Instrument status page display

6.6 Channel settings

For setting the channel the following dedicated screen appears:

Channel settings	
Resolution	2
Low range	-200.00 °C
High range	850.00 °C
<div> <div>OFFSET ON</div> <div>SCAL. ON</div> <div>HOLD ON</div> <div>FILTER ON</div> </div>	

Figure 75 – Channel setting screen

6.6.1 Offset On – Offset Off

The Offset On/Off button is used to zeroing or restoring the measure/display of the actual active channel.

Press the button Offset on to zeroing the measure (the button shows the indication “Offset off”): if the button is clicked again the Offset Off function is activated (the button shows the indication “Offset on”).

The text “OFS” on the blue bar of the main screen indicates that the function is activated.

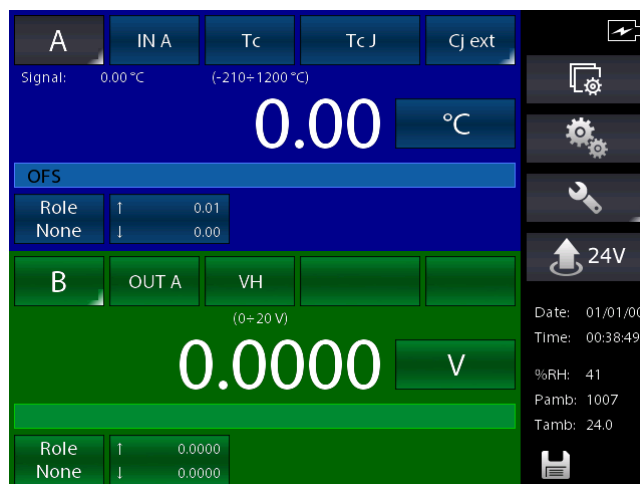


Figure 76 – Offset function activated

6.6.2 Scaling

The engineering unit can be changed by the user by using the Scaling function.

By pressing the Scaling button the following information are available:

Low scaling: min. value of the signal and reading scale (i.e. 0 Kg @ 0 bar)

High scaling: max. value of the signal and reading scale (i.e. 10 Kg @ 5 bar)

Eng. Unit Scl: customized engineering unit of the measuring signal

Decimals num.: number of decimal digits requested

Transfer functi.: linear, square root, square

Scaling parameters setup		
Low	Scl	0.000 kg
		0.00000 bar
High	Scl	10.000 kg
		5.00000 bar
Eng. unit Scl		kg
Decimals num.		3
Transfer. funct.		linear

Figure 77 – Scaling parameters setting

After setting the parameters go back to the previous screen by shorty pressing the button Scaling ON.

The main screen now displays the active function by showing the text “SCL” on the blue bar. The measuring value with the new unit is displayed with big numbers, and the actual measuring value is displayed with small numbers, close the indication “Signal”. The following screen shows two channels and the first one displays the active Scaling function:

GB



Figure 78 – Channel with active Scaling function

6.6.3 Hold On – Hold Off

The HOLD ON-HOLD OFF button is used to freeze what displayed for the selected channel. Press HOLD ON to hold the values: HOLD OFF will appear. Press it to unlock the channel. HOLD ON will appear again

HOLD on the display means that the values are hold. See below:

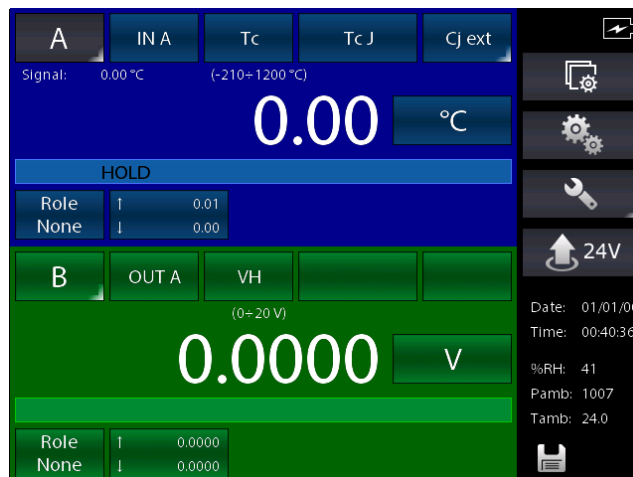


Figure 79 – Channel with HOLD enabled

6.6.4 Modification of the generation/simulation value

The generated/simulated value of an Output card or KEY can be modified from the main screen directly, by pressing the value:



Figure 80 – Generation / simulation value modifying

By pressing the value indicated on the picture above you can select the value of the signals within the limits specified during the assignment (clearly indicated under “min” e “Max” on the left side) with the help of a keyboard:

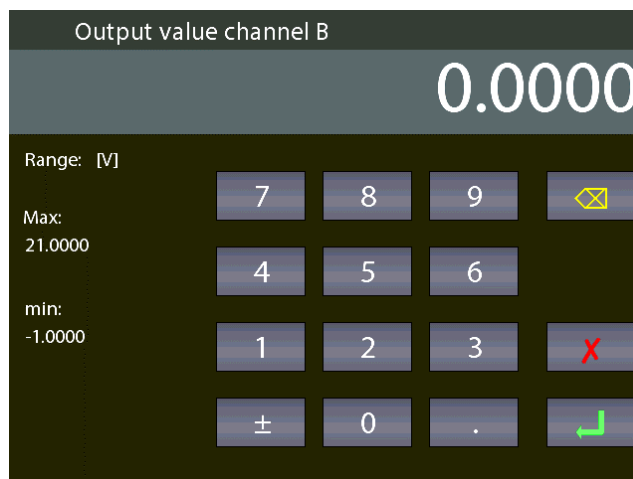


Figure 81 – Modification of generation/simulation value

6.7 Report

To create a report one channel has to be set as REF (*Reference*) and another one as DUT (*Device Under Test*): reference signal and direct measurement (or manual input by keyboard) are required. For the REFERENCE: remember to set the range equivalent to the one of the DUT. When the channel is assigned as reference, the symbol REF will appear.

For the DUT: remember to define the max error and the declaration. A bargraph will be displayed on the DUT channel. When the channel is device under test, the symbol DUT will appear.

Options are available on the screen for the Functions Setting (see paragraph 6.5.2.):

GB

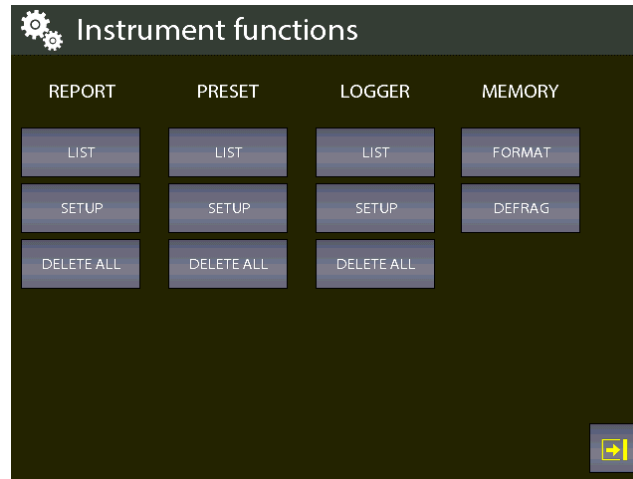


Figure 82 – Functions setting

On the REPORT column the available options are:

LIST View Reports
SETUP Reports setup
DELETE ALL Deletes all the Reports

On the PRESET column the available options are:

LIST View preset list
SETUP Preset set up
DELETE ALL Delete all the presets

Press SETUP to create a new Report.
 Info required are:

Report name
 DUT model (Device Under Test)
 DUT Serial Number (Device Under Test)
 Operator
 Job Number
 Found Left
 Up Down
 N. Points

A standard Report configuration for the calibration of a pressure transmitter 0-1 bar range is available here below

Report Setup	
Report Name	rptalpha
Dut Model	pressure transm.
Dut Serial Number	178FE
Operator	adg
Job Number	ce5mk
Dry Block type	None
Found Left	As found As left
Up Down	Up Down
N. Points	10
<div> <div>STORE</div> <div>▼</div> <div>➔</div> </div>	

Figure 83 – Report setup, page 1

Report Setup	
Found Left	As found As left
Up Down	Up Down
N. Points	10
First point	0.00000 bar
Last point	1.00000 bar
<div> <div>STORE</div> <div>▲</div> <div>➔</div> </div>	

Figure 84 – Report setup, page 2

Once completed Press STORE per memorize the data.
The following screen will appear:

Warning	
Store report setup	
Do you want store report setup ?	
YES	NO

Figure 85 – Store Report request

Press YES to store the report set up and then press again yes to run the report.

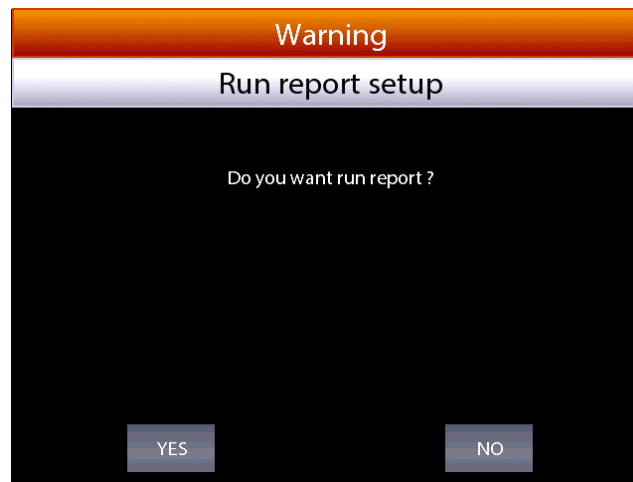


Figure 86 – Report run request

The main screen will be displayed as per below:



Figure 87 – Report running display

On the bottom, the report name (rpt1), the calibration point (1 of 20) and the related reference value (0.00000) will be shown. Press STORE to store the first calibration point: the switch to the second point is done automatically (pnt 2 will be shown), and so on for all the predefined calibration points. Pay attention to the bargraph in the DUT display: check if point is inside or outside the limit specified during the DUT assignment.

Once the calibration cycle is defined, the generation of an electrical signal is done automatically.

For the pressure, instead, the operator has to reach the required pressure values using the manual pump and the fine adjustment.

During the configuration process the operator can name the report: the same can be recalled when the same procedure is required.

In any moment the operator can stop the calibration pressing ABORT.

To make the zero on the reference channel REF, press OFFSET ON before storing the first calibration point: this function is displayed as OFS on the channel display, under the measurement value.

Press again OFFSET OFF to come back to the original configuration: OFS will disappear.

Once the last calibration point is done, press STORE (or ABORT): the Report will end automatically and the display will go back to its original configuration.

On the screen for the Functions Setting (see paragraph 6.5.2.) press LIST to view the stored reports:

Report list		
cc	01/01/00	1
rpt1	14/04/17	2
rptalpha	14/04/17	3
tt	13/01/17	4
tt2	13/01/17	5
ii	13/01/17	6
jj	VOID	7
sw2	01/01/00	8
sw5	01/01/00	9
<div> <div>▼</div> <div>▶</div> </div>		

Figure 88 – Display Report list

The above picture shows the list of the existing report: name and status are displayed. Under the status, the writing AS FOUND is displayed when the calibration data refers to a calibration process done on an instrument without any adjustment: when a date is available this means that calibration process is complete (AS FOUND AS LEFT). If the report has never been run, VOID will be displayed next to the name.

Press the arrows to move the cursor up and down to select the report, press the button with light grey background to visualize the information available in the report.

To cancel the reports press and keep pressed the button with light grey background: a confirmation is required by the operator before proceeding.

Selecting the area with light grey background next to the report name, the SETUP of the report will be displayed:

View Report setup		rptalpha	
Channel B			
ROLE:	REF PASCAL 100/IS	SN:65034	
CONNCT:	P1	RANGE:	0÷21 bar g
LOW:	0.00000 bar	HIGH:	1.00000 bar
Channel A			
ROLE:	DUT pressure transm. SN:178FE		
CONNCT:	IN A	RANGE:	±100 mA
LOW:	4.0000 mA	HIGH:	20.0000 mA
Max Err.:	0.100 %	Error decl.:	% of span
REF-DUT relation:	linear		
Channel C			
CONNCT:	None	RANGE:	
LOW:	0	HIGH:	0
Channel D			
CONNCT:	None	RANGE:	
LOW:	0	HIGH:	0
RUN		POINTS	RESULT
		NEW RPT	▶

Figure 89 – Display Report setup

Pressing POINTS, the list of the calibration points will be shown:

View points		rptalpha
1	0.00000 bar	
2	0.11111 bar	
3	0.22222 bar	
4	0.33333 bar	
5	0.44444 bar	
6	0.55555 bar	
7	0.66666 bar	
8	0.77777 bar	
9	0.88888 bar	
10	1.00000 bar	
11	1.00000 bar	
12	0.88888 bar	
13	0.77777 bar	
14	0.66666 bar	
15	0.55555 bar	
16	0.44444 bar	
17	0.33333 bar	
18	0.22222 bar	
19	0.11111 bar	
20	0.00000 bar	

Figure 90 – Display test points Report

Pressing RESULT, the calibration results are shown:

View Report result		rptalpha
14/04/17 Atm 999 Rh 36% T 25.2 °C		
As found Up		
DUT	REF	Error
1 0.0195 mA	0.06238 bar	-31.11%*
2 0.0194 mA	0.06239 bar	-31.11%*
3 0.0194 mA	0.06239 bar	-31.11%*
4 0.0194 mA	0.06239 bar	-31.11%*
5 0.0195 mA	0.06239 bar	-31.11%*
6 0.0194 mA	0.06239 bar	-31.11%*
7 0.0195 mA	0.06239 bar	-31.11%*
8 0.0196 mA	0.06239 bar	-31.11%*
9 0.0193 mA	0.06239 bar	-31.11%*
10 0.0194 mA	0.06238 bar	-31.11%*
OFFSET OFF		
As found	As left	Up
Down	Scrolling menu	

Figure 91 – Display Report results

The buttons on the bottom of the screens allow to access further points (if present): “As found”, “As left”, “Up”, “Down”, will appear to enable to see the calibration results related to the different calibration stages.

“As found”, (calibration points before any adjustment on the DUT) “As left” (calibration points after the adjustment on the DUT has been carried out), “Up” (calibration points going up), “Down” (calibration points going down).

On the screen for the Functions Setting (see paragraph 6.5.2.) press DELETE ALL to delete all the reports in the memory.

Note: a confirmation message will appear before deleting all data

6.7.1 Report of Tc/Rtd with dry well calibrator or dry block management

The Pascal calibrator allows to create reports for Thermocouples/Thermoresistances by using a dry well calibrator and by automatically manage the temperature points. With the serial interface the Pascal calibrator is able to connect to some dry well calibrators and automatically set the temperature value e and detect the reached stability in order to automatically store the temperature points and then run the test autonomously.

The Pascal calibrator can manage the following dry well calibrators:

- All models of the Scandura BL-x Series
- All models of the WIKA CTD-9100-x Series

- WIKA model CTD-9100-1100
- Giussani's dry well calibrators Pyros Series

The models of the WIKA CTD-9100-x Series require an adapter kit for the conversion from RS-232 to RS-485. The order code for the kit is: 241113.

GB

NOTE: for some dry well calibrators a switching on safety condition could prevent the automatic setting of a set point. In this case the operator must disable this feature. Please read the user manual supplied with the dry well calibrator for further details.

For managing of this report the Pascal calibrator also must be equipped with almost 2 IN interfaces, where one interface must be connected to a reference thermometer (RED) and the second one to the device under test (DST), both used into the same well dry calibrator.



An RTD or a thermocouple can be used for both the reference thermometer (REF) and the device under test (DST):

Example:

GB



Press **REPORT** e set it by using the command **SETUPRPT**:

Report Setup	
Report Name	btds1
Dut Model	thermocouple
Dut Serial Number	t66
Operator	adg
Job Number	k9x3
Dry Block type	CTD-CTB9100-x V1.x
Dry Block baudrate	9600
Stabil. wait time	00:15:00
Stabilization time	00:01:00
<div>STORE</div> <div>▼</div> <div>➔</div>	

Report Setup	
Stabilization band	0.05 °C
Found Left	As found
Up Down	Up
N. Points	4
First point	100.00 °C
Last point	400.00 °C
<div>STORE</div> <div>▲</div> <div>➔</div>	

The following parameters have to be configured at first in order to create reports for Thermocouples/Thermoresistances:

“DST model”: set the type of thermometer by selecting “thermocouple” or “RTD”. Do not leave the field as “not defined” otherwise the Pascal Report software will be not able to run the proper report type.

“Dry well type”: select the dry well calibrator connected to the Pascal calibrator

“Dry well Baud rate”: set the Baud rate value that must be the same used by the dry well calibrator.

Note: some dry well calibrators require the interface converter kit.

“Stab. Wait. Time”: set the stability waiting time in the hh:mm:ss format. The Pascal calibrator, after setting the temperature point for the report for the serial interface, will wait this dead time before starting to detect the temperature stability value.


“Stab. Time” and “Stab. Band”: the algorithm for detecting the stability value will consider the temperature stable by using the two set parameters. When the instrument will detects a stable temperature, the report will store the values of the thermometers and then will proceed to the next set point.

The “Stab. Band” parameter indicates the temperature range where the temperature value must not fall within for the set time. This allows to detect a stable temperature value.

The value describes above depend of the type of the connected dry well calibrator and its setting specifications.

Consider the following chart:

GB

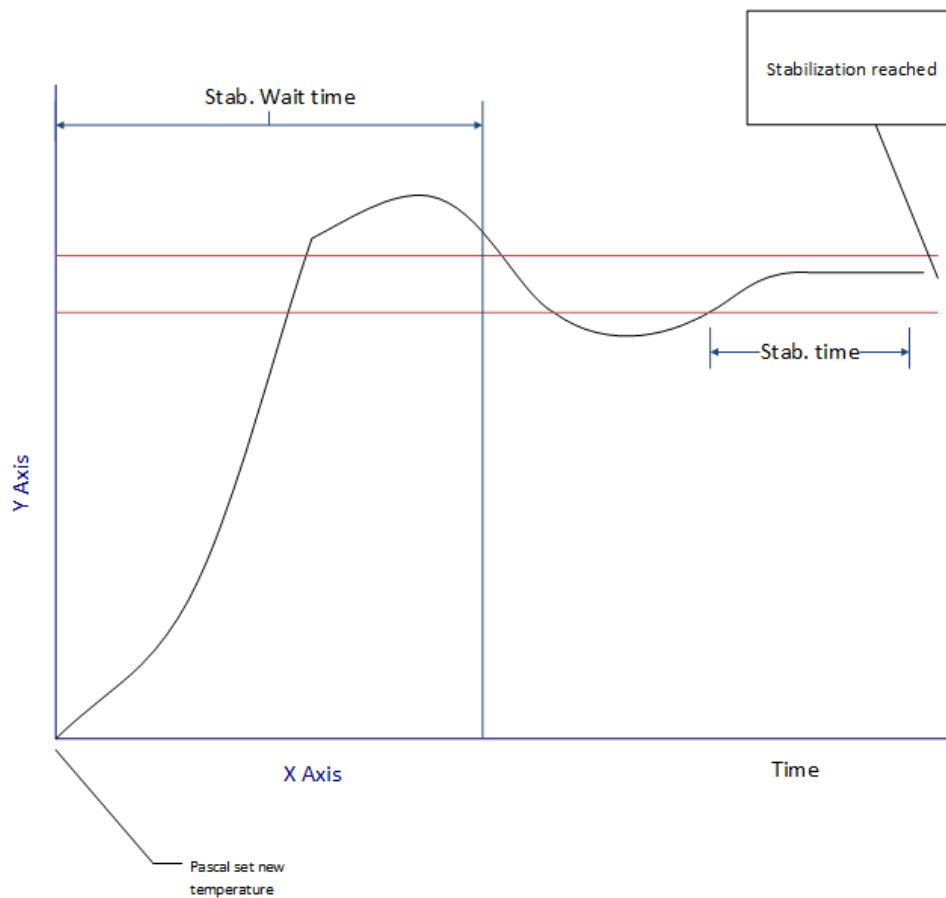

Run the report and the instrument display:



The display shows the status "Stab. Wait. Time" with the remaining time indication.

When the stabilization time is reached the instrument will enter the searching for stabilization:

The display shows two channels of temperature measurement:

- Channel A (REF):** Signal: 0.6916 mV, Range: (-270+1370 °C), Temperature: 17.37 °C. Role: REF, I: CJ under, J: CJ under, Stabilization time: 00:00:51.
- Channel B (DUT):** Signal: 1.0196 mV, Range: (-210+1200 °C), Temperature: 20.01 °C. Role: DUT, I: 20.01, J: 20.00, Error: 2.617%, btds1.Pnt 1 of 4 100.00.

Buttons on the right include: REPORT, STORE, OFFSET ON, AUTO ON, ABORT, Date: 14/04/17, Time: 14:27:01, %RH: 38, Pamb: 997, Tamb: 25.1.

The display shows the parameter “Stabilization Time”: the value will come back to the starting value as soon as the temperature goes outside the set range. The counting will start again and, starting from the new time counting, the instrument will check that the temperature value will not change over the set range.

The stability is reached when the timing reaches zero. Then, the instrument will store the REF and DST values and will start with the next point by repeating the previous steps for all the points set for the Report.

Importing the Report on a PC by using the Pascal Report Software:

The report can be imported on a PC when completed in order to be printed. The software will use the proper template based on the set “thermocouple” or “RTD” parameter:

The screenshot shows the Pascal Report Software interface with a completed calibration report template. The report includes the following sections:

- CALIBRATION REPORT1** (Report N.: [blank])
- Device under test data:** Manufacturer: [blank], Model: Thermocouple, Type: [blank], Serial number: t66, Class: [blank].
- Report setup:** Procedure: btds1, Job number: k9x33, Cal. direction: Up, Nr. of points: 2.
- CALIBRATION DATA**
- Reference instrument data:** Manufacturer: Wika, Type: PASCAL 100/IS, Serial number: 00001, Certification N.: [blank].
- Reference probe data:** Type: [blank], Certification N.: [blank].
- Ambient data:** Pressure: --- mbar, Rel. humidity: --- %, Temperature: --- °C.
- Calibration results:**

No.	Set point (°C)	Ref. input (°C)	DUT input (°C)	Error (°C)
1	100.00	100.77	100.93	0.16
2	400.00	400.48	400.75	0.27
- NOTE:** [blank]
- Test done by:** adg, **Created by:** [blank], **Approved by:** [blank]
- Test date:** 03.11.2001, **Creation date:** [blank], **Approval date:** [blank]

This template differs from the standard one in some freely settable fields as indicated below:

GB

Field Description	Value
report number	
customer name	
customer address	
customer country	
manufacturer	
dut type	
class	
ref. instrument certification n.	
ref. probe type	
ref. probe certification n.	
note_1	
note_2	
note_3	

This template will also shows the errors in the set engineering unit and not in percentage.

6.8 Data Logger

Options are available on the screen for the Functions Setting (see paragraph 6.5.2.):

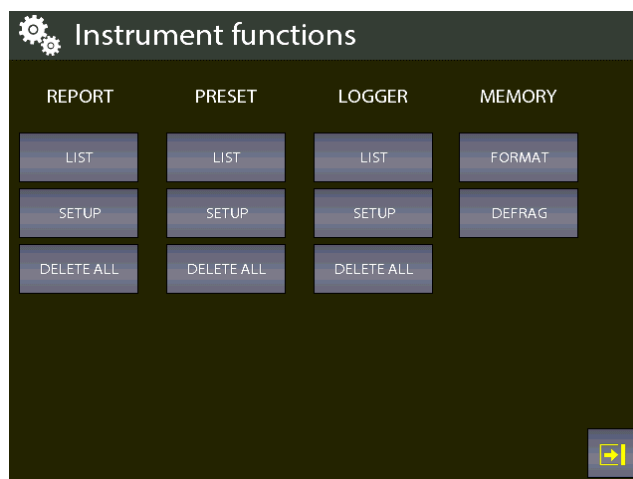


Figure 101 – Logger screen

On the LOGGER column, the following options are available:

LIST set up of the Logger
SETUP View Logs data
DELETE ALL delete all the Logs

With this function you can configure the data logger for all 4 channels simultaneously.

Selecting SETUP, "Data Logger Setup" will be displayed as per the below:

Log Name	Name of the Log (compulsory)
Sampling time	sampling time between 2 measurements (hours, min., sec.)
Sampling length	total time of the logging

Pressing START, the logging process will start:

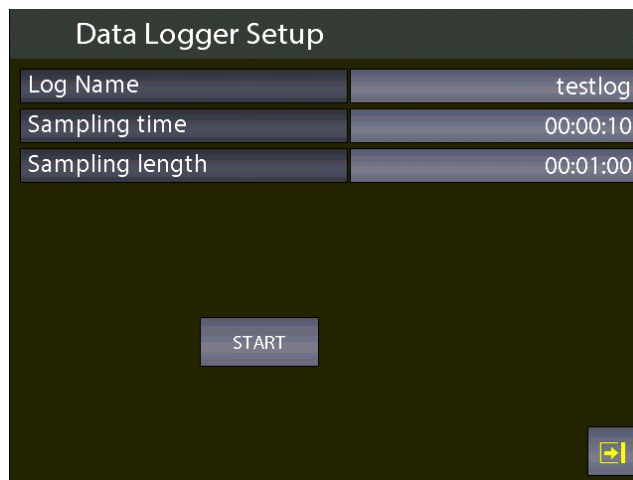


Figure 102 – Logger data setup

The flashing of the disc icon, on the bottom right side of the screen, shows that the LOGGER is active. The data will be stored on all 4 Channels (if assigned) simultaneously

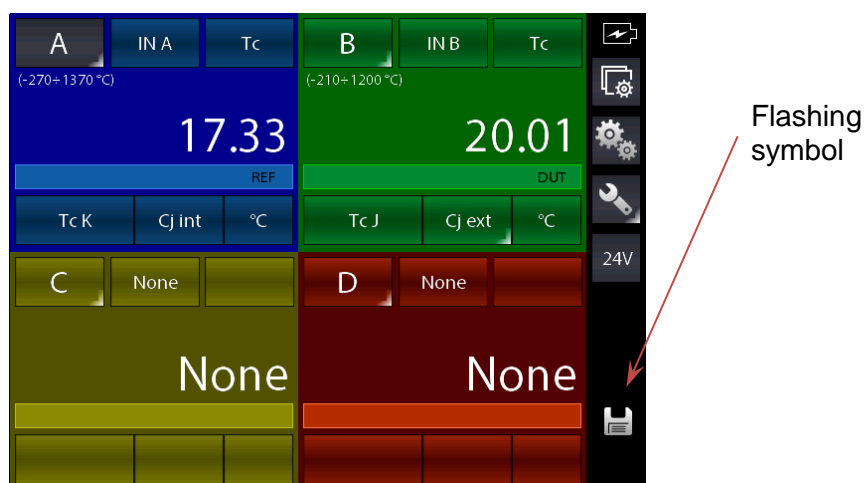


Figure 103 – Logger running

By pressing DELETE ALL on the LOGGER column on the screen of the Functions Setting, all the logs will be deleted: a confirmation will be asked to the user before proceeding.

Press the button LIST to show all the stored logs.

Log List		
yy	1	61
testlog	2	7
testlog2	3	7

Figure 104 – Display Log list

Press the button with grey background next to the log name to see the data of each log. You can DELETE the selected log by pressing and keeping pressed the button with grey background next to the log name: a confirmation will be asked to the user before proceeding.

6.9 Communication

With the Software Program PascalReport, all reports can be downloaded to a PC. Through the Software Program PasLog, all logs can be downloaded to a PC.



Following configuration is required for the download of the data: press the button

Setup instrument	
Date	10/04/17
Time	12:01:18
Date format	dd/mm/yy
Language	english
Serial baudrate	460800
AutoPoweroff time	0 min
Lock scr. PowerON	OFF
F Key assign	Not assigned

Figure 105 – Display instrument setup

6.10 Calibration Examples

6.10.1 Example 1 – Calibration of 2-wire pressure transmitters


Pascal 100 or Pascal 100/IS generates 24 V d.c. power supply to the transmitter. The 4-20 mA output signal from the transmitter is sent to be measured to an electrical input signals card IN A or IN B.

The pressure reference value to the transmitter is generated by the hand pump and by the fine volumetric regulator, both present in the calibrator, and measured as REF by the calibrator itself. The figure below shows how to connect the transmitter to the calibrator.



Figure 106 – Pressure transmitter calibration example

A typical configuration of Pascal100 for the calibration of a pressure transmitter is illustrated in the following figure:

- Set a channel for pressure values reading, assigned as REF
- Set a channel for mA reading at the inputs IN A or IN B (if present), assigned as DUT
- Enable the 24 V power supply by pressing the button  from the side bar
- Make the connections as indicated on the picture above

6.10.2 Example 2 – Calibration of PTZ gas volume converters

Pascal 100 or Pascal 100/IS can be used to calibrate a gas volume converter, where the absolute pressure, the temperature value and the Z factor are used to convert the gas volume measurement.

Gas volume, calculated at standard conditions.

The following figure shows the use of the calibrator.

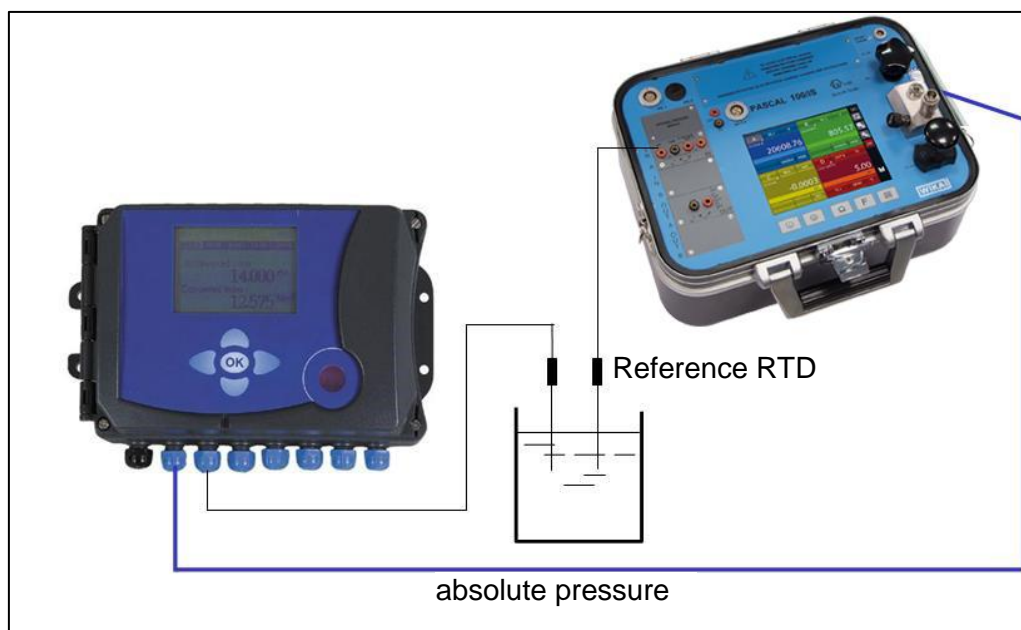


Figure 107 – PTZ Gas volume converter calibration example

6.10.3 Example 3 – Calibration of 4-wire RTD's

A 4-wire RTD can be calibrated by using the method of comparison, connecting it to the input (IN A) as a DUT (Device Under Test) and comparing it with a reference RTD connected to the other input (IN B) as REF (Reference),

GB

In this way the two measures can be compared, the calculated error is reported on the calibration report.

The figure below shows the connection of the calibrator

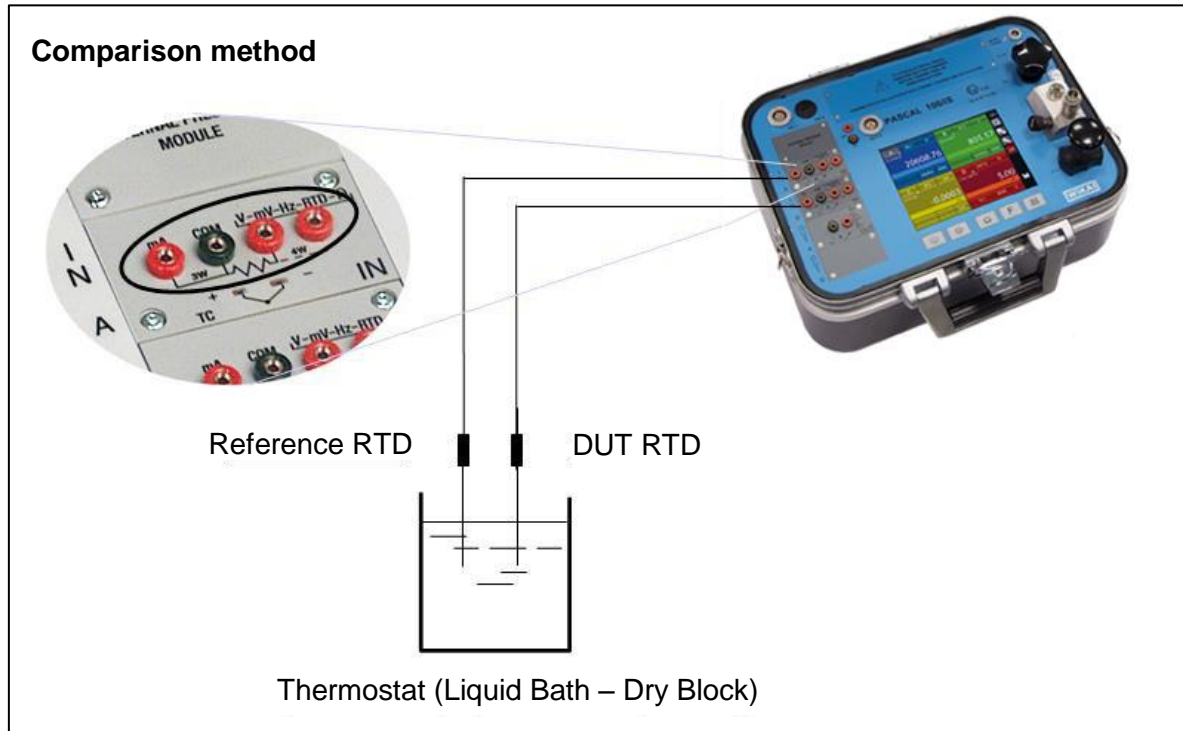


Figure 108 – 4-wire thermoresistance calibration example

6.10.4 Example 4 – Calibration of Thermocouples

The calibration of thermocouples is similar to that of RTDs, i.e. by comparison, except for the choice of the type of reference thermocouple to be used accordingly to the types of thermocouples to be calibrated.

You must also select the cold junction compensation if the internal, external or assigning a compensation value.

The figure below shows the connection of the calibrator:

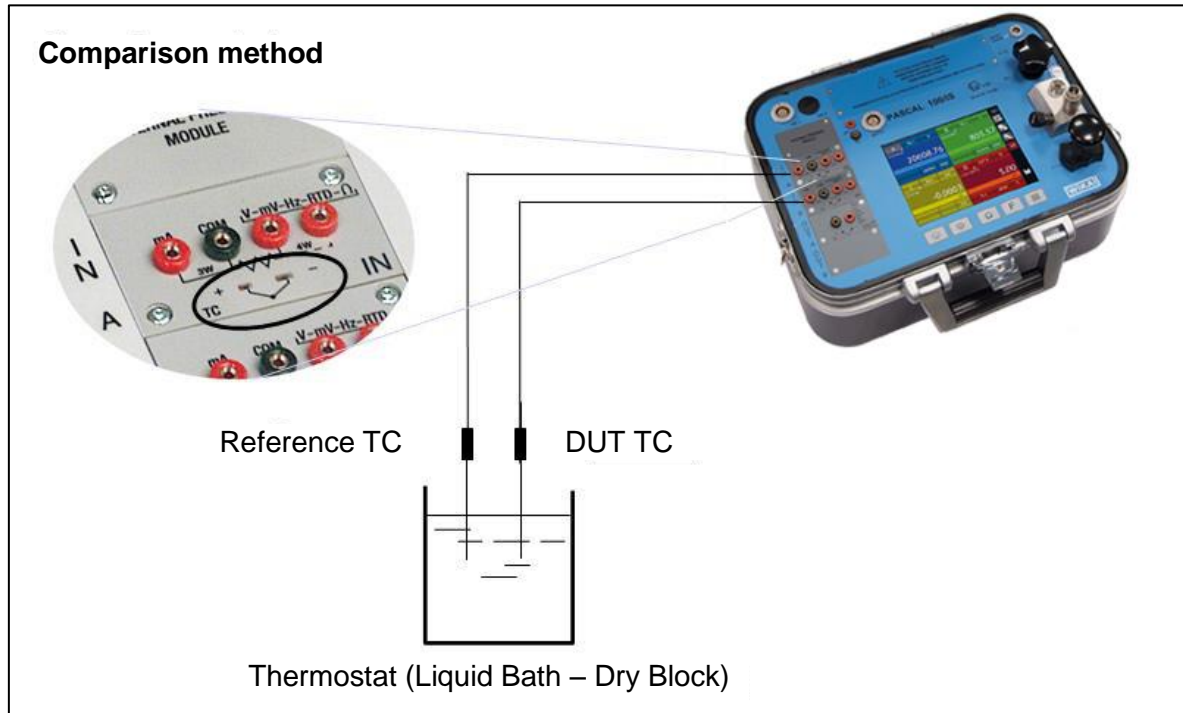


Figure 109 – Thermocouple calibration example

7 Maintenance, cleaning and servicing

GB

7.1 Maintenance

The Multichannel Calibrator model Pascal 100 or Pascal 100/IS is maintenance-free. Repairs must only be carried out by the manufacturer.

7.2 Cleaning



CAUTION!

- Before cleaning, correctly disconnect the Multichannel Calibrator model Pascal 100 or Pascal 100/IS from the pressure supply, and switch it off.
- Clean the Multichannel Calibrator model Pascal 100 or Pascal 100/IS with a moist cloth.
- Electrical connections must not come into contact with moisture.



For information on returning the instrument see chapter “8.2 Return”

7.3 Recalibration

DKD certificate - Certificates:

We recommend that the instrument is regularly recalibrated by the manufacturer, with time intervals of approx. 12 months. Every factory recalibration includes, additionally, an extensive free-of-charge check of all system parameters with respect to their compliance with the specification. The basic settings will be corrected if necessary.

8 Dismounting, return and disposal



WARNING!

Residual media in dismantled reference pressure sensors can result in a risk to persons, the environment and equipment.
Take sufficient precautionary measures.

8.1 Dismounting

Only disconnect test- and calibration installations once the system has been depressurised!

8.2 Return



WARNING!

Strictly observe when shipping the instrument:

All instruments delivered to WIKA must be free from any kind of hazardous substances (acids, bases, solutions, etc.).

When returning the instrument, use the original packaging or a suitable transport package.

To avoid damage:

1. Wrap the instrument in an antistatic plastic film.
2. Place the instrument, along with the shock-absorbent material, in the packaging. Place shock-absorbent material evenly on all sides of the shipping box.
3. If possible, place a bag, containing a desiccant, inside the packaging.
4. Label the shipment as transport of a highly sensitive measuring instrument.

Enclose the completed return form with the Multichannel Calibrator model Pascal 100 or Pascal 100/IS.



The return form is available on the internet:
www.wika.de / Service / Return


8.3 Disposal

Incorrect disposal can put the environment at risk.

Dispose of instrument components and packaging materials in an environmentally compatible way and in accordance with the country-specific waste disposal regulations.

GB

[illegible]

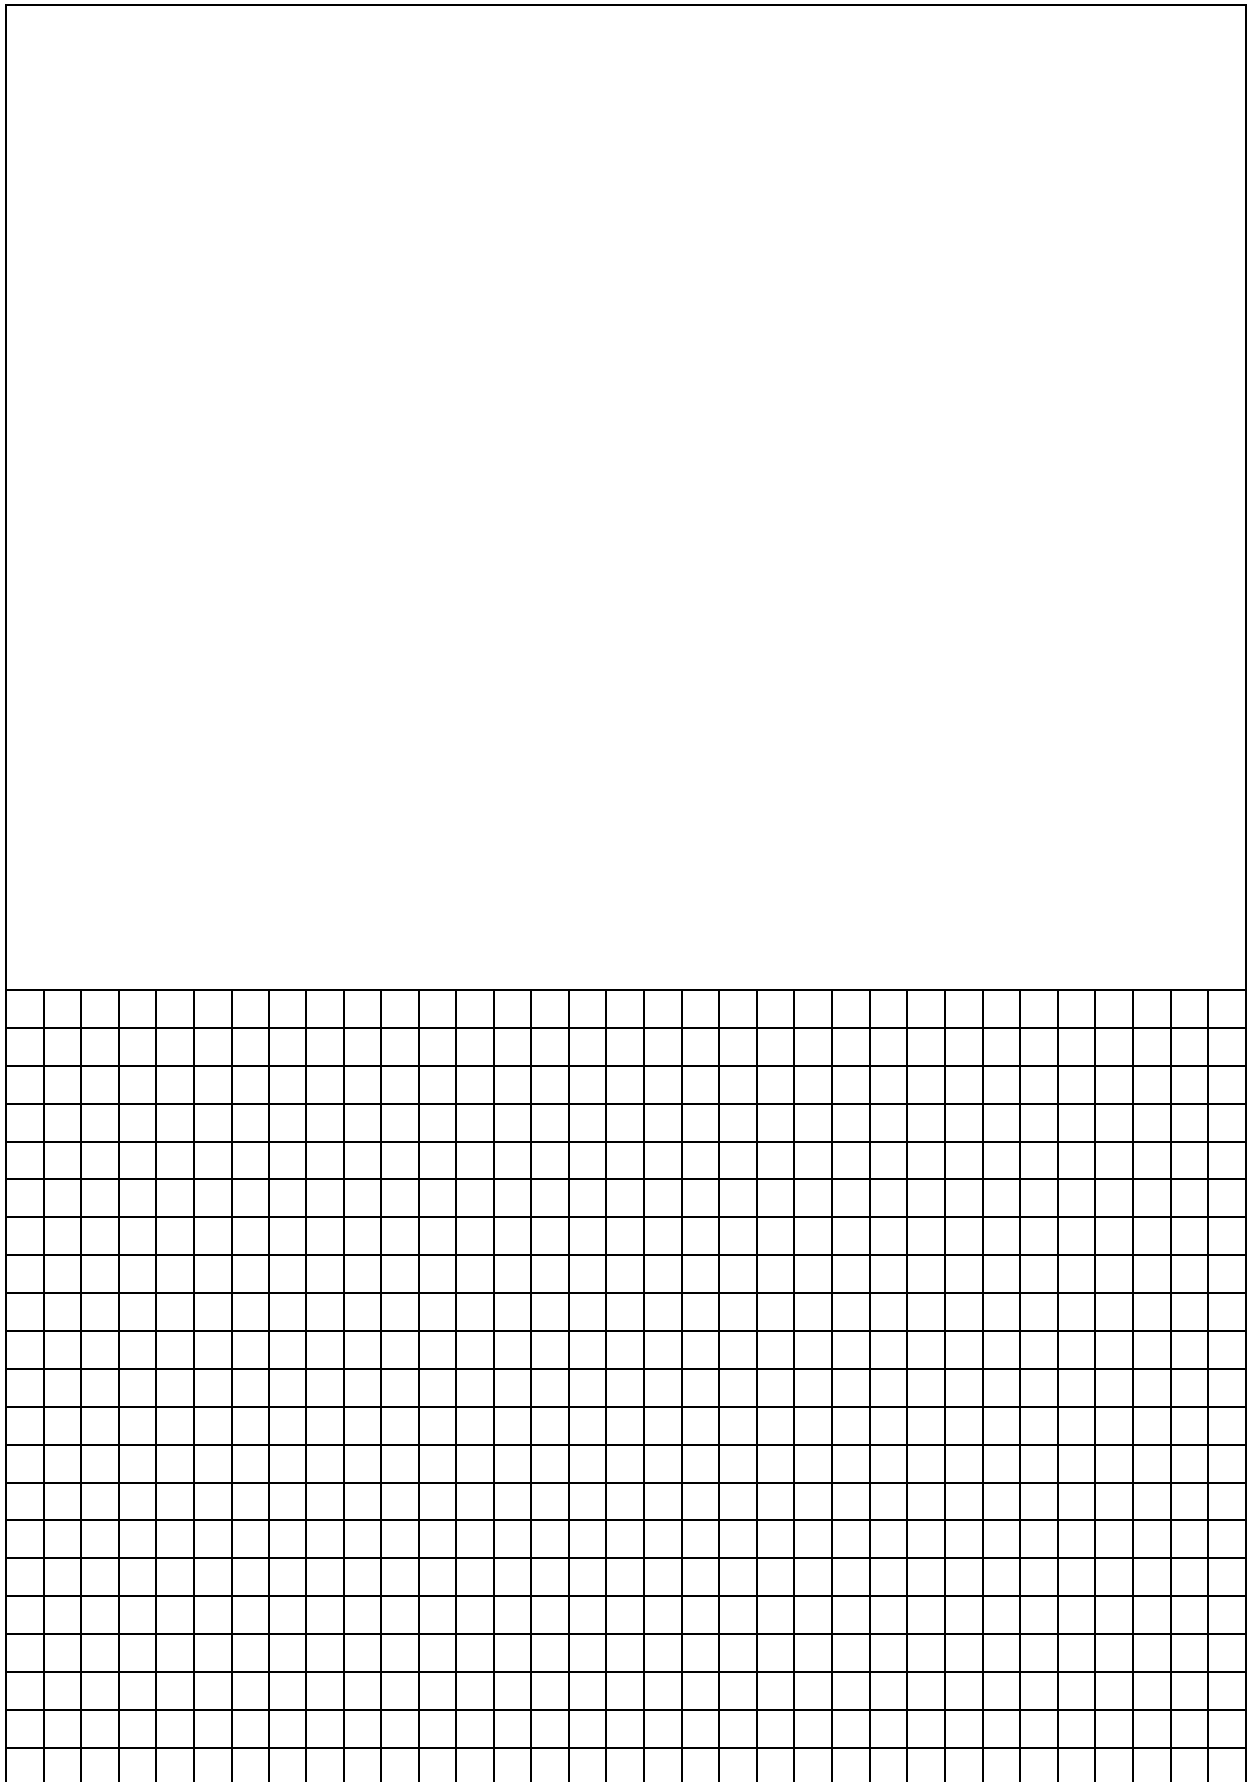



WIKA Global

Europe

Austria

WIKA Messgerätevertrieb
 Ursula Wiegand
 GmbH & Co. KG
 1230 Vienna
 Tel. (+43) 1 86916-31
 Fax: (+43) 1 86916-34
 E-Mail: info@wika.at
www.wika.at

Belarus

WIKA Belarus
 Ul. Zaharova 50B
 Office 3H
 220088 Minsk
 Tel. (+375) 17-294 57 11
 Fax: (+375) 17-294 57 11
 E-Mail: info@wika.by
www.wika.by

Benelux

WIKA Benelux
 6101 WX Echt
 Tel. (+31) 475 535-500
 Fax: (+31) 475 535-446
 E-Mail: info@wika.nl
www.wika.nl

Bulgaria

WIKA Bulgaria EOOD
 Bul. „Al. Stamboliiski“ 205
 1309 Sofia
 Tel. (+359) 2 82138-10
 Fax: (+359) 2 82138-13
 E-Mail: t.antonov@wika.bg

Croatia

WIKA Croatia d.o.o.
 Hrastovicka 19
 10250 Zagreb-Lucko
 Tel. (+385) 1 6531034
 Fax: (+385) 1 6531357
 E-Mail: info@wika.hr
www.wika.hr

Finland

WIKA Finland Oy
 00210 Helsinki
 Tel. (+358) 9-682 49 20
 Fax: (+358) 9-682 49 270
 E-Mail: info@wika.fi
www.wika.fi

France

WIKA Instruments s.a.r.l.
 95610 Eragny-sur-Oise
 Tel. (+33) 1 343084-84
 Fax: (+33) 1 343084-94
 E-Mail: info@wika.fr
www.wika.fr

Germany

WIKA Alexander Wiegand
 SE & Co. KG
 63911 Klingenberg
 Tel. (+49) 9372 132-0
 Fax: (+49) 9372 132-406
 E-Mail: info@wika.de
www.wika.de

Italy

WIKA Italia Srl & C. Sas
 20020 Arese (Milano)
 Tel. (+39) 02 9386-11
 Fax: (+39) 02 9386-174
 E-Mail: info@wika.it
www.wika.it

Poland

WIKA Polska S.A.
 87-800 Wloclawek
 Tel. (+48) 542 3011-00
 Fax: (+48) 542 3011-01
 E-Mail: info@wikapolska.pl
www.wikapolska.pl

Romania

WIKA Instruments Romania
 S.R.L.
 Bucuresti, Sector 5
 Calea Rahovei Nr. 266-268
 Corp 61, Etaj 1
 Tel. (+40) 21 4048327
 Fax: (+40) 21 4563137
 E-Mail: m.anghel@wika.ro
www.wika.ro

Russia

ZAO WIKA MERA
 127015 Moscow
 Tel. (+7) 495-648 01 80
 Fax: (+7) 495-648 01 81
 E-Mail: info@wika.ru
www.wika.ru

Serbia

WIKA Merna Tehnika d.o.o.
 Sime Solaje 15
 11060 Belgrade
 Tel. (+381) 11 2763722
 Fax: (+381) 11 753674
 E-Mail: info@wika.co.yu
www.wika.co.yu

Spain

Instrumentos WIKA, S.A.
 C/Josep Carner, 11-17
 08205 Sabadell (Barcelona)
 Tel. (+34) 933 938630
 Fax: (+34) 933 938666
 E-Mail: info@wika.es
www.wika.es

Switzerland

MANOMETER AG
 6285 Hitzkirch
 Tel. (+41) 41 91972-72
 Fax: (+41) 41 91972-73
 E-Mail: info@manometer.ch
www.manometer.ch

Turkey

WIKA Instruments Istanbul
 Basinc ve Sicaklik Ölçme
 Cihazlari
 Ith. Ihr. ve Tic. Ltd. Sti.
 Bayraktar Bulvari No. 17
 34775 Yukari Dudullu - Istanbul
 Tel. (+90) 216 41590-66
 Fax: (+90) 216 41590-97
 E-Mail: info@wika.com.tr
www.wika.com.tr

Ukraine

TOV WIKA Prylad
 M. Raskovoy Str. 11, A
 PO 200
 02660 Kyiv
 Tel. (+38) 044 496-8380
 Fax: (+38) 044 496-8380
 E-Mail: info@wika.ua
www.wika.ua

United Kingdom

WIKA Instruments Ltd
 Merstham, Redhill RH13LG
 Tel. (+44) 1737 644-008
 Fax: (+44) 1737 644-403
 E-Mail: info@wika.co.uk
www.wika.co.uk

North America

Canada

WIKA Instruments Ltd.
 Head Office
 Edmonton, Alberta, T6N 1C8
 Tel. (+1) 780 46370-35
 Fax: (+1) 780 46200-17
 E-Mail: info@wika.ca
www.wika.ca

Mexico

Instrumentos WIKA Mexico S.A.
 de C.V.
 01210 Mexico D.F.
 Tel. (+52) 55 55466329
 Fax: (+52) 55 50205300
 E-Mail: ventas@wika.com
www.wika.com.mx

USA

WIKA Instrument Corporation
 Lawrenceville, GA 30043
 Tel. (+1) 770 5138200
 Fax: (+1) 770 3385118
 E-Mail: info@wika.com
www.wika.com

WIKA Instrument Corporation
 Houston Facility
 950 Hall Court
 Deer Park, TX 77536
 Tel. (+1) 713-475 0022
 Fax: (+1) 713-475 0011
 E-mail: info@wikahouston.com
www.wika.com

Mensor Corporation
 201 Barnes Drive
 San Marcos, TX 78666
 Tel. (+1) 512 3964200-15
 Fax: (+1) 512 3961820
 E-Mail: sales@mensor.com
www.mensor.com

South America

Argentina

WIKA Argentina S.A.
 Buenos Aires
 Tel. (+54) 11 47301800
 Fax: (+54) 11 47610050
 E-Mail: info@wika.com.ar
www.wika.com.ar

Brazil

WIKA do Brasil Ind. e Com. Ltda.
 CEP 18560-000 Iperó - SP
 Tel. (+55) 15 34599700
 Fax: (+55) 15 32661650
 E-Mail: marketing@wika.com.br
www.wika.com.br

Chile

WIKA Chile S.p.A.
 Coronel Pereira 72
 Oficina 101
 Las Condes Santiago de Chile
 Tel. (+56) 9 66084258
www.wika.cl

Asia

China

WIKA International Trading
 (Shanghai) Co., Ltd.
 A2615, NO.100, Zunyi Road
 Changning District
 200051 Shanghai
 Tel. (+86) 21 538525-72
 Fax: (+86) 21 538525-75
 E-Mail: info@wika.cn
www.wika.com.cn

WIKA Instrumentation
 (Suzhou) Co., Ltd.
 81, Ta Yuan Road
 SND, Suzhou 215011
 Tel. (+86) 512 6878 8000
 Fax: (+86) 512 6809 2321
 E-Mail: info@wika.cn
www.wika.com.cn

India

WIKA Instruments India Pvt. Ltd.
 Village Kesnand, Wagholi
 Pune - 412 207
 Tel. (+91) 20 66293-200
 Fax: (+91) 20 66293-325
 E-Mail: sales@wika.co.in
www.wika.co.in

Japan

WIKA Japan K. K.
 Tokyo 105-0023
 Tel. (+81) 3 543966-73
 Fax: (+81) 3 543966-74
 E-Mail: info@wika.co.jp

Kazakhstan

TOO WIKA Kazakhstan

050050

050050 Almaty, Kazakhstan

Tel. (+7) 32 72330848

Fax: (+7) 32 72789905

E-Mail: info@wika.kz

www.wika.kz

Korea

WIKA Korea Ltd.
 #569-21 Gasan-dong
 Seoul 153-771 Korea
 Tel. (+82) 2 869 05 05
 Fax: (+82) 2 869 05 25
 E-Mail: info@wika.co.kr
www.wika.co.kr

Malaysia

WIKA Instrumentation (M)
 Sdn.Bhd
 47100 Puchong, Selangor
 Tel. (+60) 3 80 63 10 80
 Fax: (+60) 3 80 63 10 70
 E-Mail: info@wika.com.my
www.wika.com.my

Singapore

WIKA Instrumentation Pte. Ltd.
 569625 Singapore
 Tel. (+65) 68 44 55 06
 Fax: (+65) 68 44 55 07
 E-Mail: info@wika.com.sg
www.wika.com.sg

Taiwan

WIKA Instrumentation Taiwan
 Ltd.
 Pinjen, Taoyuan
 Tel. (+886) 3 420 6052
 Fax: (+886) 3 490 0080
 E-Mail: info@wika.com.tw
www.wika.com.tw

Thailand

WIKA Instrumentation Cor-
 poration (Thailand) Co., Ltd
 850/7 Ladkrabang Road,
 Ladkrabang
 Bangkok 10520
 Tel. (+66) 2 326 6876-80
 Fax: (+66) 2 326 6874
 E-Mail: info@wika.co.th
www.wika.co.th

Africa / Middle East

Egypt

WIKA Near East Ltd.
 El-Serag City Towers
 -Tower#2 - Office#67
 Nasr City Cairo
 Tel. (+20) 2 22733140
 Fax: (+20) 2 22703815
 E-Mail: wika.repcairo@wika.de
www.wika.com.eg

Namibia

WIKA Instruments Namibia
 (Pty) Ltd.
 P.O. Box 31263
 Pionierspark
 Windhoek
 Tel. (+26) 4 6123 8811
 Fax: (+26) 4 6123 3403
 E-Mail: info@wika.com.na
www.wika.com.na

South Africa

WIKA Instruments (Pty.) Ltd
 Gardenview,
 Johannesburg 2047
 Tel. (+27) 11 62100-00
 Fax: (+27) 11 62100-59
 E-Mail: sales@wika.co.za
www.wika.co.za

United Arab Emirates

WIKA Middle East FZE
 Jebel Ali, Dubai
 Tel. (+971) 4 8839-090
 Fax: (+971) 4 8839-198
 E-Mail: wikame@emirates.net.ae
www.wika.ae

Australia

Australia

WIKA Australia Pty. Ltd.
 Rydalmere, NSW 2116
 Tel. (+61) 2 88455222
 Fax: (+61) 2 96844767
 E-Mail: sales@wika.com.au
www.wika.com.au

New Zealand

WIKA Instruments Limited
 Unit 7 / 49 Sainsbury Road
 St Lukes - Auckland 1025
 Tel. (+64) 9 8479020
 Fax: (+64) 9 8465964
 E-Mail: info@wika.co.nz
www.wika.co.nz