alphasense
AMETEK®

Technical specifications Version 1.0

PH3-A1 Phosphine Sensor

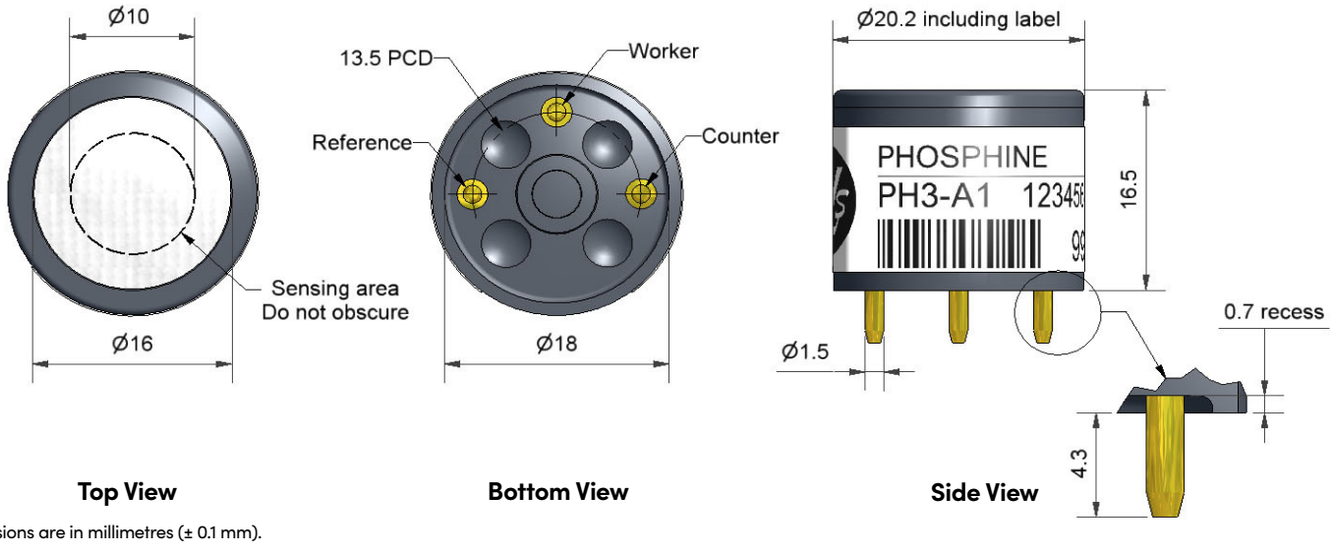

Top View **Bottom View** **Side View**

Dimensions are in millimetres (± 0.1 mm).

Performance	Sensitivity	nA/ppm in 11ppm PH_3	550 to 900
	Response time	t90 (s) from zero to 5ppm PH_3	< 25
	Zero current	ppm equivalent in zero air	< ± 0.5
	Resolution	RMS noise (ppm equivalent)	< 0.1
	Range	ppm PH_3 limit of performance warranty	10
	Linearity	ppm error at full scale, linear at zero, 20ppm PH_3	< -0.6
	Overgas limit	maximum ppm for stable response to gas pulse	75
Lifetime	Zero drift	ppm equivalent change/year in lab air	< ± 0.05
	Sensitivity drift	% change/year in lab air, monthly test	< 10
	Operating life	months until 80% original signal (24-month warranted)	> 24
Environmental	Sensitivity @ -20°C	% (output @ -20°C/output @ 20°C) @ 11ppm PH_3	20 to 70
	Sensitivity @ 50°C	% (output @ 50°C/output @ 20°C) @ 5ppm PH_3	130 to 160
	Zero @ -20°C	ppm equivalent change from 20°C	< ± 0.04
	Zero @ 50°C	ppm equivalent change from 20°C	< ± 0.04

Cross Sensitivity	H_2S sensitivity	% measured gas @ 20ppm	H_2S	< 15
	NO_2 sensitivity	% measured gas @ 10ppm	NO_2	< -30
	Cl_2 sensitivity	% measured gas @ 10ppm	Cl_2	< -30
	NO sensitivity	% measured gas @ 50ppm	NO	< 1
	SO_2 sensitivity	% measured gas @ 20ppm	SO_2	< 60
	CO sensitivity	% measured gas @ 400ppm	CO	< 0.7
	H_2 sensitivity	% measured gas @ 400ppm	H_2	< 0.2
	C_2H_4 sensitivity	% measured gas @ 80ppm	C_2H_4	< 10
	NH_3 sensitivity	% measured gas @ 25ppm	NH_3	< 0.2
	CO_2 sensitivity	% measured gas @ 5% volume	CO_2	< 0.1

Key Specifications	Temperature range	°C	-30 to 50
	Pressure range	kPa	80 to 120
	Humidity range	% rh continuous	20 to 90
	Storage period	months @ 0 to 20°C (stored in original container)	6
	Load resistor	Ω	10 to 33
	Bias voltage	mV	not required
	Weight	g	< 6

T: +44 (0)1376 556700 **E:** sensors@alphasense.com **W:** www.alphasense.com

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. or visit our website at "www.alphasense.com".

Figure 1 Sensitivity Temperature Dependence

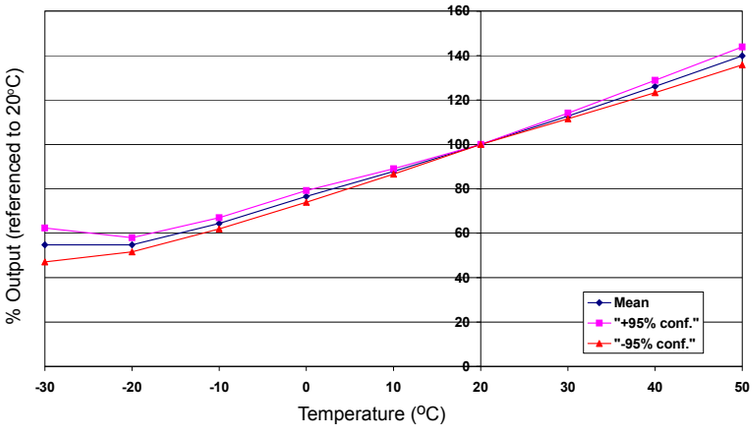

Figure 1 shows the variation in sensitivity caused by changes in temperature.

This data is taken from a typical batch of sensors. The mean and ±95% confidence intervals are shown.

Figure 2 Zero Temperature Dependence

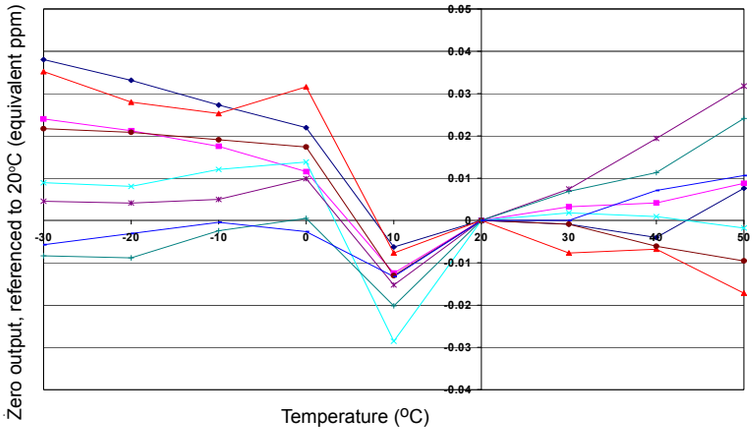

Figure 2 shows the variation in zero output caused by changes in temperature expressed as ppm gas equivalent, referenced to zero at 20°C.

This data is taken from a typical batch of sensors.

Figure 3 Linearity

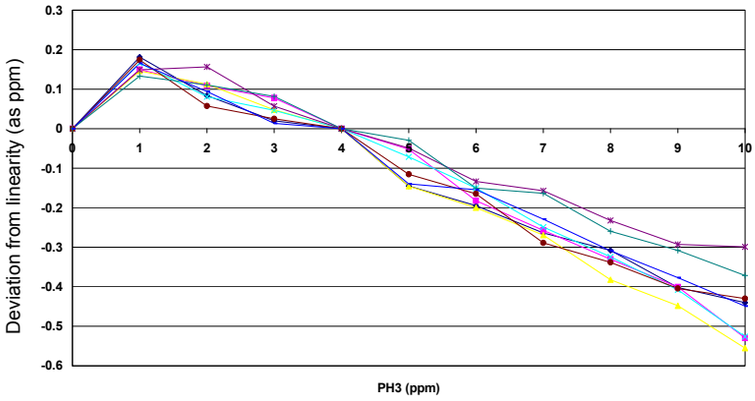

Figure 3 shows variation from linearity to 10ppm. Software correction between 0 and 0.5ppm can improve overall linearity.

Repeatable performance means linearity can be corrected in software.